APPRO... ...RNER
P.A. 345 0
Houghton County
Roland W. Crowley
Dec. 10, 1997

SURVEY & REMONUMENTATION

JAN 0 9 1998

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

NANCY FENILI 12/11/97
HOUGHTON COUNTY 11:20
LC 3/ 445 PAU Fee: 9.00
Page 1 of 1

For corners in HOUGHTON (County) Located In: Corner Code #

1. Public Land Survey — T 55N R 32W — C8
   T 55N R 32W — C9
   T___ R___
   T___ R___
2. Property Controlling — S___ T___ R___
   in Section — S___ T___ R___
3. Miscellaneous — S___ T___ R___
   Property in Sec. — S___ T___ R___

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

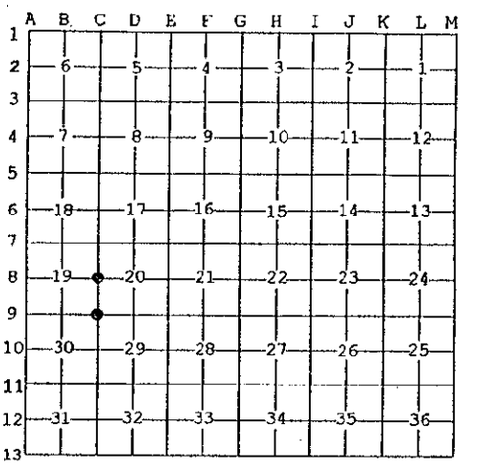

November 20, 1997

I, Steven C. Hein, in a field survey on _____, 19___ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(C8) From Original notes: 40.00 Set qr. Section post; Y. Birch 10 S20E 04; Spruce 9 N71W 19. No evidence of original corner.
(C9) From Original notes: West 80.00 Set post corner of Sections 19, 20, 29, 30; Cedar 8 S45E 03; Do 10 N80W 08. No evidence of original corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C8) Set Quarter Corner on line between and equidistant from found Section corners to North and South. Corner falls East of old North/South fence. Set Houghton County Remonumentation brass cap.
(C9) Found 2" pipe witnesses by John I. Haataja, P.S. 19833, but unrecorded. Found witnesses: 6" Cedar N44E 12.40'; 8" Cedar S86E 19.07'; 14" Cedar S41E 28.18'; 10" Cedar N30W 4.76'. Replaced 2" pipe with Houghton County Remonumentation brass cap.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(C8) Set 2 1/4" Brass cap on 3/4" pipe
Witnesses:
10" Cedar N45E 17.39'
12" Cedar S10E 14.79'
" Spruce S76W 9.53'
12" Cedar N24W 24.90'
Witnesses have nail & tag #32336

(C9) Set 2 1/4' Brass cap on 3/4" pipe
Witnesses with tag #19833:
6" Cedar N44E 12.40'
8" Cedar S86E 19.07'
14" Cedar S41E 28.18'
10" Cedar N30W 4.76'
New Witness with tag #32336:
8" Cedar N19W 24.72'

STATE OF MICHIGAN
STEVEN C. HEIN
PROFESSIONAL SURVEYOR
No. 32336
PROFESSIONAL SURVEYOR

Signed by Steven C Hein Date Nov. 25, 1997

Surveyor's Michigan License No. 32336

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995