SURVEY & REMONUMENTATION

OCT 29 1996

COMMISSION

Re-Mon Liber 1, Page 18

REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Huron (County)

	Located In:	Corner Code #
1. Public Land Survey	Paris T15N R14E	G-13, H-13
	T___ R___	
	T___ R___	
	T___ R___	
2. Property Controlling in Section	S___ T___ R___	
	S___ T___ R___	
3. Miscellaneous Property in Sec.	S___ T___ R___	
	S___ T___ R___	

STATE OF MICHIGAN
HURON COUNTY
RECORDED

10 SEP 96 8:42 A.M.

FRANCES L. HOLDWICK
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

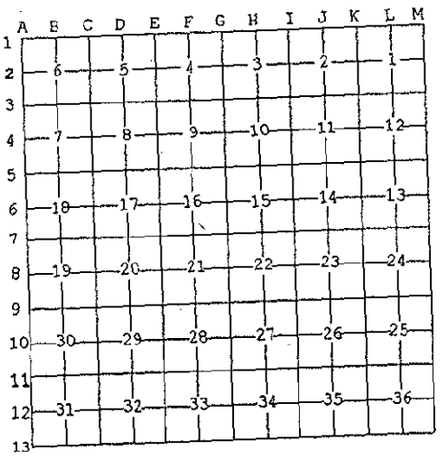

I, Charles S. Getz, in a field survey on July 2, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G-13 GLO Notes
Set Post at 80.00 chains
Beech 13", N53-1/2°E, 46 Links
Do. 11", N13°W, 33 1/2 Links

County Surveyor's Record - Iron Rod,
Act 74 - None, Act 132 - None

H-13 GLO Notes
Set 1/4 Post at 40.00 Chains
Hemlock 11", N51-1/2°W, 11 Links
Cedar 7", N30°E, 14 Links

County Surveyor's Record - Iron Pin over Stone
Act 74 - None, Act 132 - None

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

G-13
SW Cor, Section 34, T15N-R14E
Found 1/2" Iron Bar in Gravel Road
(Intersection of Huron Line Road and Polk Road)

APPROVED PEER BOARD MEETING
RLB Sept 9, 1996

H-13
S 1/4 Cor, Section 34, T15N-R14E
Found 5/8" Iron Bar in Gravel Road Bed (Huron Line Road), 2' below Road surface.
Raised with 1/2" Iron Bar.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-13
SW Cor, Section 34, T15N-R14E
1/2" Iron Bar in Gravel Road Bed
N45°E 60.85' to Nail in SE Side of Power Pole
S45°E 42.90' to Telephone Box
N45°W 40.85' to Stop Sign
S15°E 136.00' to Nail in W. Side of Power Pole
West 2651.36' to S 1/4 Cor, Sec 33, T15N-R14E
East 2640.76' to S 1/4 Cor, Sec 34, T15N-R14E

H-13
S 1/4 Cor, Section 34, T15N-R14E
1/2" Iron Bar in Gravel Road Bed
S15°E 44.06' to Nail in W. Side of 12" Poplar
S45°E 38.20' to West End of 24" C.M.P.
S60°E 56.40' to East End of 24" C.M.P.
West 2640.76' to SW Cor, Sec 34, T15N-R14E
East 2638.76' to SE Cor, Sec 34, T15N-R14E

Signed by Charles S. Getz Date July 15, 1996

Surveyor's Michigan License No. 25843

State of Michigan
Charles S. Getz
Land Surveyor
No. 25843
Professional Surveyor

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995