LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

Iron (County)

	Located In:		Corner Code #
1. Public Land Survey		T____ R____	
		T____ R____	
		T____ R____	
	S____	T____ R____	
2. Property Controlling	S 4	T 41N R 32W	16
in Section	S 4	T 41N R 32W	13
3. Miscellaneous	S____	T____ R____	
Property in Sec.	S____	T____ R____	

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat_____
5. Private Claims

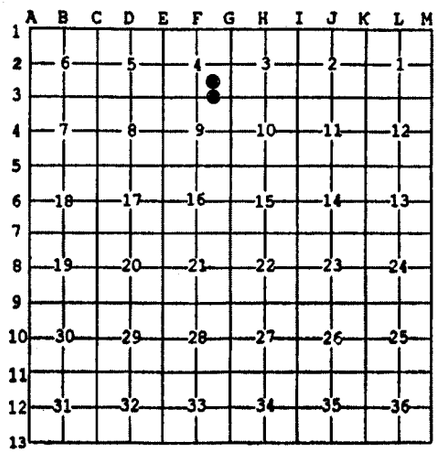

Sep 14 2006

I, Stephan J. Szyszkoski, in a field survey on _____, 20 ____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(16-Sec. 4) East 1/16 corner between Sections 4 and 9. 1978 - Established by A.O.Enger RLS midway and on line between Section and Quarter corners. 20.009 chains East and West. Set 1"I.D. x 36" iron pipe with 3 3/4" aluminum cap. Red Maple 5 N52E 23.8', Red Oak 6 N33W 23.3'.
(13-Sec. 4) Southeast 1/16 corner, Section 4. Not established in the original survey.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(16-Sec. 4) Recovered the 1978 monument in good condition and at record bearing and distance from the 1978 BTs, both in good condition. Left the monument in place and made new witnesses as described below.
(13-Sec. 4) Established the corner at the intersection of straight lines connecting opposite 1/16 corners.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(16) Fd. 1"ID I.pipe with 3 3/4" alum. MDNR cap. Set measuring nails in:
6" Maple N57E 24.3' old blazes *
9" Oak N29W 23.4' do *
12" Oak S49E 12.6' mrkd "1/16S BT"
9" Maple S77W 34.8' do
Bearings are magnetic. Distances are to nail with tag. * denotes 1978 BT. Set sq'd cedar post adjacent.

(13) Set 1"IDx32" I.pipe with 4" alum. MDNR cap. Set measuring nails in:
10" Oak N26E 10.25' mrkd "1/16S BT"
4" Maple S65E 7.8' do
13" Oak S22W 10.5' do
9" Oak N88W 1.6' do
Set sq'd cedar post adjacent. Bearings are magnetic. Distances are to nail with tag.

STATE OF MICHIGAN
STEPHAN J. SZYSZKOSKI
LAND SURVEYOR
No. 33986
LICENSED LAND SURVEYOR

Signed by Stephan J. Szyszkoski Date 9/26/06

Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources, Office of Land and Facilities

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
Revised May 14, 1975
Revised Jan., 1983
Revised Oct., 1995