SURVEY & REMONUMENTATION

MAR 0 3 1998

SECTION

KENT COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN
COUNTY OF KENT
RECEIVED FOR RECORD
97 JUN -3 AM 8: 11
REG. OF DEEDS

9994

Register of Deeds Stamp & File Number

For corners in KENT COUNTY (County)

	Located in:	Corner Code #
1. Public Land Survey	T6N R9W	I-2
	T___ R___	
	T___ R___	
	T___ R___	
2. Property Controlling	S___ T___ R___	
in Section	S___ T___ R___	
3. Miscellaneous	S___ T___ R___	
Property in Sec.	S___ T___ R___	

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

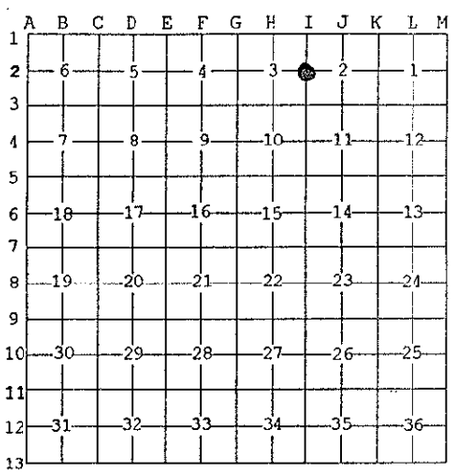

I, Kirk Breitels, in a field survey on May 5, 19 97 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

I-2	1830	GLO	Mullett	Set Post
		Kent Co. Wit.		Iron
	1977	LCRC #1069	Merdzinski	"T" fence post in C/L ditch
	1982	LCRC #3030	Jonker	"T" fence post in C/L ditch
	1990	LCRC #5473	Starr	"T" fence post in C/L ditch

The position of this corner was previously approved by the Kent County Remonumentation Peer Group, recorded by Robert J. Jonker on 7/7/82 and was recorded per LCRC #3030.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-2 Found 3/4" Solid Iron in C/L 8' wide ditch per witnesses from above LCRC ("T" fence post) as recorded by Robert J. Jonker. Said 3/4" Solid Iron checks with LCRC #1069.

LCRC #3030		LCRC #5473
NE corner hse. fnd.	S60°W 118.5'	same witnesess
NW corner brick bldg.	S20°E 64.04'	as LCRC #3030
Remon. tag Tw. 6" Ash	S75°E 112.9'	
Top C/L cor. fc. post	S00°E 47.85'	

The selected location is accepted by me and is generally accepted by professional surveyors as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-2 3/4" Solid Iron in C/L 8' wide drainage ditch (running E-W)

NE corner house foundation	S60°W 118.70'
NW corner brick bldg. (nursing home)	S20°E 64.00'
Set Nail & KC Remon. tag N. side Tw. 16" Ash	S75°E 112.64' (old scar 112.9')
Top C/L corner fence post (to South & East)	S00°E 47.93'

Top of Iron is at water level (5/5/97)
On fence line to South ±

Signed by Kirk Breitels

Date 5/22/97

Surveyor's Michigan License No. 30077

STATE OF MICHIGAN KIRK BREITELS LAND SURVEYOR NO. 30077 LICENSED LAND SURVEYOR

P.A. 345 1990 KENT COUNTY
PEER APPROVED 5/22/97
CHAIRMAN Stanley Mulkee

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14,1975
REVISED JAN., 1983
REVISED OCT., 1995