SURVEY &
REMONUMENTATION

APR 2 8 1996

COMMISSION

REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

RECEIVED FOR RECORD

95 SEP -7 PM 3:06

LIBER NO. 5 PAGE NO. 272

Melissa DeVaugh

REGISTER OF DEEDS
LAPEER COUNTY, MICHIGAN

For corners in
LAPEER
(County)

		Located In:	Corner Code #
		Burnside South 9N 12E	M-5
1. Public Land Survey		T ____ R ____	
		T ____ R ____	
		T ____ R ____	
		T ____ R ____	
2. Property Controlling	S ____	T ____ R ____	
in Section	S ____	T ____ R ____	
3. Miscellaneous	S ____	T ____ R ____	
Property in Sec.	S ____	T ____ R ____	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

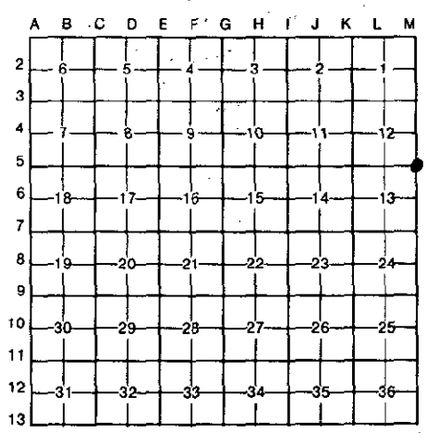

I, Earl E. Gravlin, in a field survey on July 19th, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

History: Parke 1834 Set Post Beech 18 N52W 28 Do 17 S47.5W 38 Common to A-5 T9N-R13E, County Surveyor None, Act 74 L1 P59 Sanilac Elrich Fnd 1/2" Iron N45E 49.15 PP S45W 48.91 PP N45W 71.15 R/W Marker Recorded Surveys L4 P243 Sanilac County, Kay 3/4" Iron in Mon Box Same as Act 74 L1 P59, L10 P587 Lapeer County, Gravlin same as Act 74 L1 P59, Unrecorded Surveys Milletics 9/21/97 Job # 87-213A Same as L4 P 243, Brown 7/7/93 Job # 93-86 as Act 74 L1 P59, Subdivisions, Hollywood & Vine Terrace L3 P11 Sanilac Records and Belzair Sub, L4, P7, Sanilac Records. Road Commission, N10°W 84.31' 19" Ash, N45°D 41.42' Power Pole, S40°E 49.10' Power Pole. Drain Commission Nothing.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Site Conditions: Found 3/4" Iron in Mon Box, Level Farmland, Intersection Asphalt Road and State Highway M-90, M-5 to M-6 2627.94, M-5 to L-5 2635.35, M-5 to M-4 2656.04, M-5 to B-5 2447.63

PEER GROUP
APPROVED LAND CORNER
PA 345 OF 1990
LAPEER COUNTY

RAY DAVIS P.S. CO. SURVEYOR
DATE 7-13-95

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

July 19th, 1995
FOUND 3/4" RE-ROD, SET 1/2" RE-ROD AND BRASS CAP
S45°W 48.85' NAIL & TAG E SIDE POWER POLE
N45°E 50.58' NAIL & TAG E SIDE POWER POLE
N50°W 77.12' NAIL & TAG E SIDE 12" MAPLE
S30°E 54.60' W LEG FACE STOP SIGN

Signed by _____ Date 8-17-95

Surveyor's Michigan License No. 23510

23510

LIBER 0005 PAGE 0272

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983