SURVEY &
REMONUMENTATION

APR 06 1999

SECTION

Approved by Menominee County
Land Survey Remonumentation
Peer Group Under Act 345 Of
P.A. Of 1990 On DEC 16 1994
Ma Davis RLS
ACTING Chairman

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
MENOMINEE
(County)

	Located In:	Corner Code #
1. Public Land Survey	T 37N R 25W	L-1
	T ___ R ___	
	T ___ R ___	
	T ___ R ___	
2. Property Controlling in Section	S ___ T ___ R ___	
	S ___ T ___ R ___	
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	
	S ___ T ___ R ___	

RECEIVED FOR RECORD
94 DEC 27 AM 10: 41
BK 4 PAGE # 170
BARBARA MORRISON
REGISTER OF DEEDS
MENOMINEE COUNTY, MICHIGAN

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

L-13 T38N-R25W

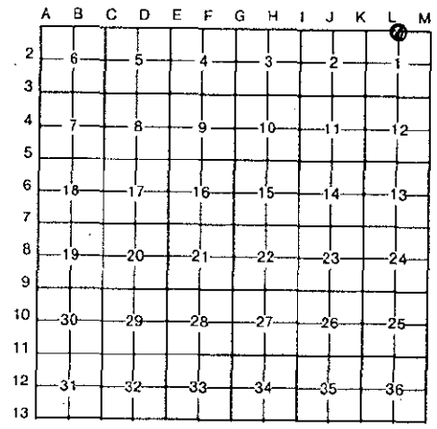

I, William Lenca, in a field survey on Sep 29, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1847: Original Survey (Township Lines) by Henry Floyd - B.T.'s - Beech, 4"- N82°W, 07 lks; Beech, 6" - N75°E - 07 lks. No original evidence found.

1968: L.C.R.C. No. 680-Vol 3 by Frank J. Bray, DNR Surveyor, states that a 1" dia. Iron Pipe/4" dia. Alum. cap was set on line and midway between section corners to the east and west. New B.T.'s - 7" Ironwood - N35°E - 21-1/2 lks; 7" Basswood - N64°W - 46 lks.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

We found a 1" dia. Iron Pipe/4" dia. Alum. cap and 2 Bearing Trees as described in part "A", in good condition. The corner position falls very nearly at the single proportionate position as intended in L.C.R.C. No. 680 - Vol. 3. We accepted the monument as a careful and faithful reestablishment of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Accepted existing 1"dia. Iron Pipe/3-1/4" dia. Alum. cap stamped for corner location:

9" dia. Ironwood - (Ex. B.T.)	N35°E	14.43 feet	Scr. NBT
6" dia. Basswood	S73°E	12.52 feet	Scr. NBT
10" dia. W. Spruce	S48°W	43.79 feet	Scr. NBT
12" dia. Basswood - (Ex. B.T.)	N64°W	30.36 feet	Scr. NBT
Survey Sign Post	N90°W	1.7 feet	

STATE OF MICHIGAN
WILLIAM LENCA
LAND SURVEYOR
No. 26461
REGISTERED LAND SURVEYOR

NOTE: All bearings are magnetic bearings. All distances are measured with steel tape. Distances to trees are to nail in side of tree.

Signed by William Lenca Date Nov. 15, 1994

Surveyor's Michigan License No. 26461

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983