8948

JAN 2 4 1996

COMMISSION

STATE OF MICHIGAN
COUNTY OF ROSCOMMON

Dec 16 9 20 AM '93

REGISTER OF DEEDS

ROSCOMMON COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Roscommon (County)

	Located In:	Corner Code ##
1. Public Land Survey	T21N R2W	M-7
	T ___ R ___	
	T ___ R ___	
	T ___ R ___	
2. Property Controlling	S ___ T ___ R ___	
in Section	S ___ T ___ R ___	
3. Miscellaneous	S ___ T ___ R ___	
Property in Sec.	S ___ T ___ R ___	

ROSCOMMON COUNTY PEER GROUP APPROVAL

DATE 11-30-93

TO BE FILED IN LIBER 3 OF LAND CORNER

Register of Deeds Stamp & File Number

4. Lot No. _____ , Recorded Plat _____
5. Private Claims _____

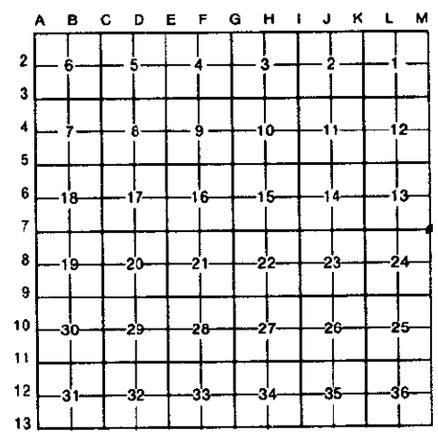

I, Larry L. Cavanagh, in a field survey on November, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

W/post placed by John Brink 1837
Birch 16" N34°W 54
Birch 11" S46°W 24

W/post found by Wm A. Burt 1850
Birch 22" N64°E 39
Birch 16" S48°E 66

1947 George D. Henning survey
1"x24" iron bar in cor
BT - 6" Maple S38°E 39.5
BT - 16" Aspen N33°E 47.2
Steel fence post set 33' East

1975± Liber 2 corner record
1"x24" Iron bar
6" Maple S38°E 39.5
16" Aspen N33°E 47.2
Steel fence post set 33' East

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Fd Maple (Now 16") SE
Pipe was fd by L. L. Cavanagh in 1974 property survey. Corner believed to be destroyed by Road Construction, re-set by above witnesses & proportionate measurement from corner to the South to 1/4 corner to the North, fits distance to 1/4 East, 1947 Henning survey and is accepted as a careful and faithful reestablishment of the position of the original corner.

See filed dossier for detail of report.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set Roscommon Co. Std. Mon in Pav't box stamped A-M-7 17614
S40°E Nail & tag in 16" Maple 40.04
N82°W Nail & tag in 12" Beech 67.73
N28°W Nail & tag in P. pole 111.98
N46°E Nail & tag in 6" Tw Beech 54.60

STATE OF MICHIGAN
LARRY L. CAVANAGH
PROFESSIONAL SURVEYOR
No. 17614
LICENSED PROFESSIONAL SURVEYOR

Signed by Larry L. Cavanagh Date 12-15-93

Surveyor's Michigan License No. 17614

Date November 30, 1993 **Peer Group Approved**

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 197
REVISED MAY 14, 197
REVISED JAN., 198