RECEIVED FOR RECORD
LIBER NO. ____ PAGE NO. 31
FILE NO. Wisner
96 DEC 10 AM 9:00
TUSCOLA COUNTY
REGISTER OF DEEDS

1996 REMONUMENTATION PROGRAM
LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

For corners in WISNER TWP.
TUSCOLA (County)

	Located In:	Corner Code #
1. Public Land Survey	T 14N R 07E	M-6
	T ___ R ___	
	T 14N R 8E	A-6
	T ___ R ___	
2. Property Controlling	S ___ T ___ R ___	
in Section	S ___ T ___ R ___	
3. Miscellaneous	S ___ T ___ R ___	
Property in Sec.	S ___ T ___ R ___	

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6	5	4	3	2	1						
3													
4		7	8	9	10	11	12						
5													
6		18	17	16	15	14	13						
7													
8		19	20	21	22	23	24						
9													
10		30	29	28	27	26	25						
11													
12		31	32	33	34	35	36						
13													

I, JONATHAN M. FIELD, in a field survey on MAY 21 19 96, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land 9anagement or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1834 GLO; RISDON, D.S.; SET POST; W. OAK 24 N33 1/4E 4.91CH, ELM 24 N35W 3.46CH.
1887 TESKEY, C.S.; SET W. OAK STAKE AND CROCKERY SINGLE PROP; MAPLE S45 1/4E 78 1/2LKS., W. OAK S61 3/4W 313LKS.
1948 WIT CARD @ ROWE ENG.; R.J. BLACK; FND IRON; SW 53.7' SE COR GAS STA, WEST 49.5' POINT OF GAS STA ISLAND, NWLY 48.4' CENTER OF DRAIN INLET, NELY 56.4' INSIDE EDGE BR. RAIL.
1954 R.J. BLACK; UNRECORDED SURVEY FOR BYRON PRIME; NO OBJECT STATED; NO WITS GIVEN
1961 WIT CARD @ ROWE ENG.; NO OBJECT STATED; NW 115.06' SE COR OLD HOTEL, NE 104.05' NW COR BRICK STORE, EAST, 68.85' SPIKE IN 24" MAPLE, NELY 56.4' INSIDE EDGE BRIDGE RAIL
1970 LEACH, P.S.#7236; SURVEY L.507,PG.496; FD 3/4" PIPE; N10E 56.4' NW COR BRIDGE RAIL, N5E 39.8' L.P., N02E 63.87' PK C/L M-25
1973 KAY ENG.; KAY, P.S.#14096; SURVEY L.432,PG.227; NO OBJECT OR WITS STATED
1973 KAY ENG.; KAY, P.S.#14096; SURVEY L.437,PG.272; 3/4" PIPE; SAME WITS AS 1970 SURVEY ABOVE
1978 GRAVLIN, P.S.#23510; SURVEY L.496,PG.1478-9; FND PIPE; N10E 22.90' W. LEG STOP SIGN POST N20E 55.70' SW COR BRIDGE ABUTMENT, WEST 9.0' C/L RD.
1979 ERICKSON, P.S.#16929; LCRC PG.31; FND 1" PIPE; S25W 126.60' 37" TW. ELM, N10E 40.24' P/P, N55E 80.29' P&T POLE.
1979 GRAVLIN, P.S.#23510; SURVEY L.495,PG.1469; FND PIPE; SAME WITS AS 1978 GRAVLIN SURVEY.
1980 ROWE ENG.; FOKENS, P.S.#21567; SURVEY L.506,PG.1121; 3/4" PIPE; SAME WITS AS 1970 SURVEY
1984 DUNTON, P.S.#23503; SURVEY L.541,PG.916; NO OBJECT STATED; NO WITS GIVEN
1985 GRAVLIN, P.S.#23510; SURVEY L.557,PG.795; NO OBJECT STATED; SAME WITS AS 1978 SURVEY ABOVE
1987 ROWE ENG.; BROWN, P.S.#33134; SURVEY L.580,PG.812 FND IRON IN MON BOX; N25E 39.67' FND CHIS "+" ON SW BRIDGE WALL, S15E 8.57' MDOT TAG IN GUARD RAIL POST, WEST 51.60' FND PK IN P/P, S50W 47.57' NE FACE GALV COR FENCE POST AT RD GRADE
1987 ROWE ENG.; BROWN, P.S.#33134; SURVEY L.580,PG.818; SAME OBJECT & WITS AS 1987 SURVEY ABOVE
1987 ROWE ENG.; OWENS, P.S.#20709; UNREC SURVEY; SAME OBJECT AND WITS AS 1987 SURVEY ABOVE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

1996 ROWE ENG.; FIELD, P.S.#37276; FND 3/4" ROD IN MON BOX; 63.9' S. OF C/L M-25 & 8.5' E. OF C/L ASPH. ROAD N-S; RECOVERED 4 PREVIOUS WITNESSES WHICH INDICATE THAT FND ROD IS IN SAME POSITION AS 1987 SURVEY CITED ABOVE
ACCEPTED FND ROD IN MON BOX AS BEST EVIDENCE OF ORIGINAL CORNER POSITION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-6 REPLACED FND. 3/4" ROD W/ 5/8" ROD & STANDARD REMON CAP STAMPED "M 6 T14N R7E" ENCASED ROD & CAP IN CONC.
N25°E, 39.67' FND CHIS. + ON SW CONC BRIDGE WALL
S15°E, 8.57' FND NAIL W/MDOT TAG IN GUARD RAIL POST
WEST, 51.60' FND P-K NAIL IN P.POLE
S50°W, 47.57' NE FACE GALV. FENCE POST NOTE: THIS CORNER IS COMMON WITH M FIELD14N R8E

Signed by Jonathan M Field Date 12-4-96

Surveyor's Michigan License No. 37276

STATE OF MICHIGAN JONATHAN M. FIELD PROFESSIONAL SURVEYOR 37276 LICENSED PROFESSIONAL SURVEYOR

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS JULY 21, 1971
REVISED MAY 1, 1975
REVISED JAN. 1, 1983
ADOPTED OR NOW PROCESSED IN MARCH, 1993

APPROVED
12-2-96
LPE
RCB

MAY 20 1997

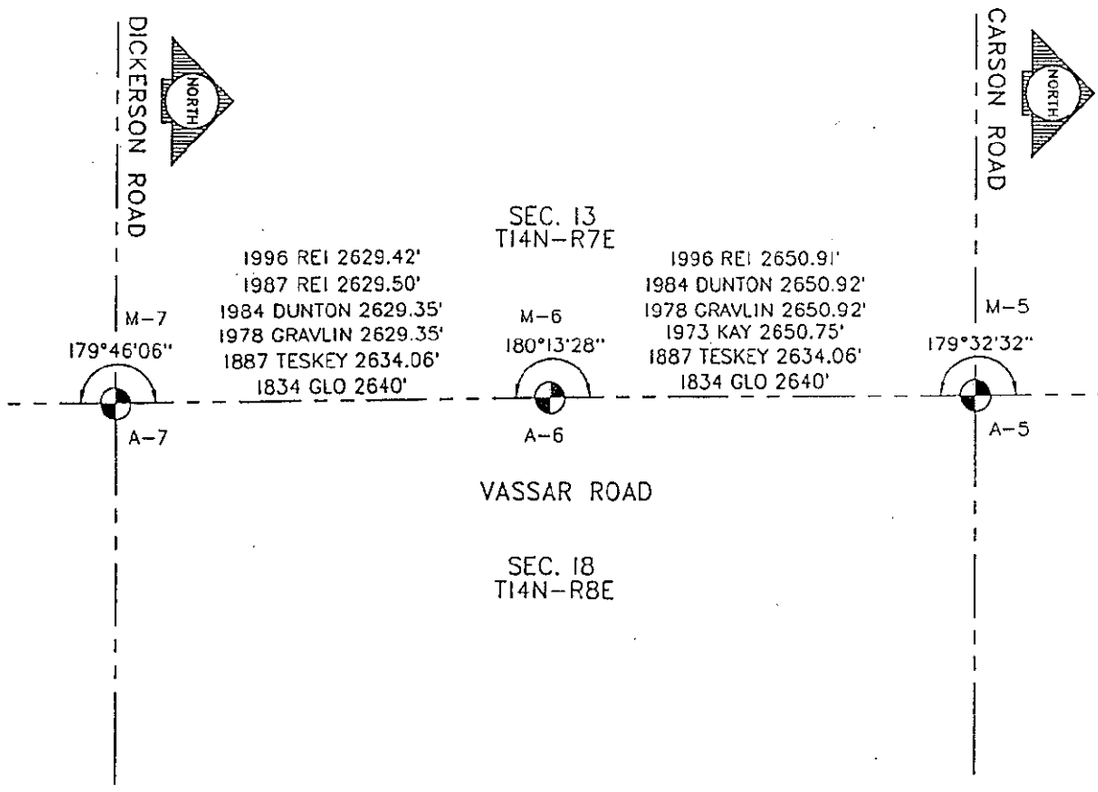
DICKERSON ROAD
NORTH
CARSON ROAD
NORTH
SEC. 13
T14N-R7E
1996 REI 2629.42'
1987 REI 2629.50'
1984 DUNTON 2629.35'
1978 GRAVLIN 2629.35'
1887 TESKEY 2634.06'
1834 GLO 2640'
1996 REI 2650.91'
1984 DUNTON 2650.92'
1978 GRAVLIN 2650.92'
1973 KAY 2650.75'
1887 TESKEY 2634.06'
1834 GLO 2640'
M-7
179°46'06"
M-6
180°13'28"
M-5
179°32'32"
A-7
A-6
A-5
VASSAR ROAD
SEC. 18
T14N-R8E