

SURVEY &
REMONUMENTATION

AUG 06 2008

SECTION OSCODA COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in _____
OSCODA _____
(County)

Located in: Corner Code #

- 1. Public Land Survey T26N R1E C-6
- 2. Property Controlling S _____
- 3. Miscellaneous S _____
- Property in Sec. S _____

APPROVED

County Remonumentation

- 4. Lot No. _____, Recorded Plat
- 5. Private Claims _____

Peer Review Group
NCC 18 JULY 08

JERI WINTON
OSCODA COUNTY
REGISTER OF DEEDS

07/29/2008 09:32:59AM
FEE: \$17.00
PAGES: 2 RCPT#: 8285
LC8-143 CORNER RECORDATION

Register of Deeds Stamp & File Number

I, Marvin E. Myers, P.S., in a field survey on Jan 10 20 08 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, re-monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

C-6 Quarter Section Corner common to Sections 17 & 18 T26N-R01E.

1839 GLO William R. Coon Deputy Surveyor

Mon - Set quarter Section Corner

Wit: Tamarack 8" N52°W 11 lks (7.26')
Tamarack 6" S47°E 56 lks (36.96')

Circa 1880's J Randall, CS

Mon - Ran a line West from this corner.

Wit: Not given

1937 USGLO Dependent Resurvey by James T. Boyd and T. Nolan

Canada, Transitman, Guy Veal, CE

Mon - Set iron Pipe 3' long 2" diam, 26" into the Ground by Proportional distance no remaining evidence of Original post or bearing trees.

6" White Birch N76°15'E 27 lks (17.82') marked

Wit: "1/4 S 17 BT"

8" Poplar N22°W 70 lks (46.2') marked "1/4 S 18

BT"

Continued on back of sheet→

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

C-6 Quarter Section Corner common to Sections 17 & 18 T26N-R01E.

Found a USGLO 2" diameter iron pipe with a 3" brass cap 14" above ground in good condition, left in place; S35°E 68.88' found a spike in the Southwest side of a dead 24" White pine with a USFS location tag; N84°W 22.07' found a nail in the North side of a 9" Spruce with a USFS location tag; North 0.5± the base of a Cedar post lying East with a USFS location tag. Accepted USGLO Iron Pipe as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

C-6 Quarter Section Corner common to Sections 17 & 18 T26N-R01E.

Mon - USGLO 2" diameter iron pipe with a 3" brass cap 14" above ground in good condition.

Wit: S35°E 68.88' Found spike in Southwest side of dead 24" White pine with USFS location tag.

N84°W 22.07' Found nail in North side of 9" Spruce with USFS location tag.

North 0.5± Base of Cedar post lying East with USFS location tag.

N54°E 34.55' Set nail & tag in Northwest side of 9" Spruce.

S44°E 35.85' Set nail & tag in Northeast side of 12" Spruce.


S54°W 40.52' Set nail & tag in Southeast side of 9" White pine.

North 2± Set Carsonite post.

East 10± C/L of North/South old trail.

East 70± C/L of North/South Power line.

	1	2	3	4	5	6	7	8	9	10	11	12	13
A													
B													
C													
D													
E													
F													
G													
H													
I													
J													
K													
L													
M													

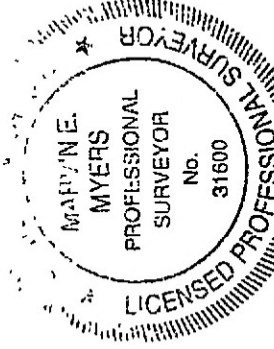

Signed by Marvin E. Myers
Surveyor's Michigan License No. 31600

Date August 6, 2008