

**SURVEY &  
REMONUMENTATION**

**AUG 06 2008**

**SECTION**

**OSCODA COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970



For corners in

OSCODA  
(County)

Located in: Corner Code #

1. Public Land Survey T26N R1E E-5
2. Property Controlling S \_\_\_\_\_  
In Section S \_\_\_\_\_
3. Miscellaneous S \_\_\_\_\_  
Property in Sec. S \_\_\_\_\_

**APPROVED**

County Remonumentation

4. Lot No. \_\_\_\_\_, Recorded Plat

Peer Review Group

5. Private Claims

*NCC 18 JULY 08*

OSCODA COUNTY

REGISTER OF DEEDS

07/29/2008 09:33:06AM

FEE: \$17.00

PAGES: 2 RCPT#: 8285

LC8-150 CORNER RECORDATION

Register of Deeds Stamp & File Number

I, Marvin E. Myers, P.S., in a field survey on March 26, 20 08, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

**E-5 Section Corner common to Sections 8, 9, 16, & 17 T26N-R1E.**

1839 William R Coon, Deputy Surveyor

1914 C O Seeley, CS

- Mon - Set post  
Wit: 4" Cedar S75°15'W 10 lks (6.60')  
12" Birch N29°W 9 lks (5.94')  
8" Birch West 406 lks (267.96')

- Mon - Found post drove 2 ft of 1 1/4" Well pipe at post  
Wit: Fd old record Gov't tree's both dead and down  
Birch badly decayed position right with 4" Cedar  
S75°15'W 10 lks showing marks of light blaze.  
Found point of stake

Circa 1880's J Randall, CS

- Mon - Notes show that he ran a line from this corner.  
Wit: Not given

- NBTs 10" Cedar N17°W 16.75 lks (11.06')  
20" Y Pine S40°30'E 47 lks (31.02')

Part A continued on back of Sheet →

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

**E-5 Section Corner common to Sections 8, 9, 16, & 17 T26N-R1E.**


Found Seeley's pipe; found USGLO Pipe and cap South 0.28.

Guy Veal's notes state: "Found iron pipe 1x6 inches above ground, set by C. O. Seeley, County Surveyor from original bearing tree in 1914 at point for corner." I believe Guy Veal set the USGLO post next to Seeley pipe as a reference and the Seeley pipe is at the position of the Original Government Corner. Seeley's pipe is accepted as a careful and faithful perpetuation of the position of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

**E-5 Section Corner common to Sections 8, 9, 16, & 17 T26N-R1E.**

- Mon - 1 1/2" Well Pipe in place.  
Wit: South 0.28 USGLO Iron Pipe with brass cap 11" above ground.  
N49°W 13.70 Nail & tag in South side 10" Balsam  
N47°E 40.14 Nail & tag in Northwest side 7" White Pine  
S89°E 19.12 Nail & tag in North side 6" twin Balsam  
S08°W 30.75 Nail & tag in West side Power Pole  
South 30± Centerline of power line  
East 200± Centerline of North-South Trail Road  
North 1± Carsonite Post

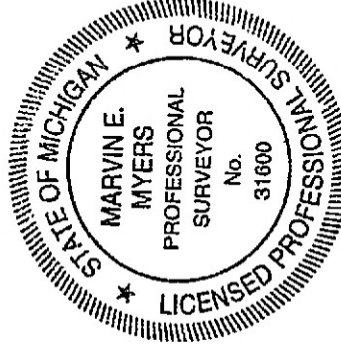

*Marvin E. Myers*

Signed by Marvin E. Myers  
Surveyor's Michigan License No. 31600

Date July 14, 2008