



**LAND CORNER RECORDATION CERTIFICATE**  
Filing Requirement of Act 74, Mich. P.A. 1970

**SURVEY &  
REMONUMENTATION**

Located in: \_\_\_\_\_ Corner Code # \_\_\_\_\_

FEB 14 2006

1. Public Land Survey \_\_\_\_\_ I 18 N R 14 W E-7  
 T N R W  
 T N R W  
 T N R W  
 T N R W  
 T N R W  
 T N R W  
 T N R W
2. Property Controlling \_\_\_\_\_ S \_\_\_\_\_  
 In Section \_\_\_\_\_ S \_\_\_\_\_  
 3. Miscellaneous \_\_\_\_\_ S \_\_\_\_\_  
 Property in Sec. \_\_\_\_\_ S \_\_\_\_\_

**SECTION**

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_ Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

I, Patrick N. Johnson, in a field survey on October 6, 2005, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 2, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

**Note: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

E-7: Corner common to Sections 16, 17, 20 & 21, Sweetwater Township, Lake County, Michigan.

**A. DESCRIPTION OF ORIGINAL MONUMENT AND ACCESSORIES AND/OR SUBSEQUENT RESTORATION:**

1838 S. Sibley, G.L.O.

- Set post  
 #1 12" Pine N15°W 10 links (6.6')  
 #2 8" Hemlock S06°W 24 links (15.8')

1937 Bill Downey LS

- M.S.H.D. survey  
 Found iron pipe  
 #9 12" Oak N33°W 31.79'  
 #10 12" Oak N88°W 38.77'  
 #11 Cap in fence post S44°W 51.75'

Undated Notes of George West (1911 +/-)

- "Identified by running X lines"  
 Shows distance of 5100.5' East and 2673.6' South.  
 #3 20" White Pine S60°30'W 63.5'  
 #4 18" White Pine stump N52°30'E 65.5'

1926 George Johnson

- "Found iron pipe and witness"  
 #5 6" White Oak Northeast 45'  
 #6 7" White Oak Northwest 63'

1964 R. Griffin LS 13584

- L.C.R.C. Liber 01, Page 102  
 Replaced 1/2" x 20" Pipe with concrete monument.  
 #5 10" White Oak N28°E 44.9'  
 #10 16" White Oak N88°W 38.80'  
 #6 13" White Oak N54°W 62.35'  
 #9 14" White Oak N23°W 31.15'

1983 C. Cole LS 17615

- Survey recorded in Liber 02, Page 473.  
 (Shows same witnesses as 1964 R. Griffin)

County survey notes (No date or name)

- "Pipe" Corner 1st 00 feet North of U.S. - 10 and 1 1/2 chains West of narrow road.  
 #7 Fence Post N68°W 45 links (29.7')  
 #8 Fence East 40 links (26.4')

1988 S. Barnett LS 16923

- Section break for U.S.F.S. shows distance of 5096' East and 2658' South.

**B. DESCRIPTION OF CORNER EVIDENCE FOUND AND/OR METHOD APPLIED IN RESTORING OR REESTABLISHING CORNER:**


I found a 5" square concrete monument stamped "T18N R14W, S16, S17, S20, S21, 1964, RLS 13584". The corner is 130 feet North of the centerline of U.S - 10, (which bears S70°W). The centerline of an old overgrown two-track road is 90 feet East of the corner. There is no other occupation. The corner fits well with all recovered accessories.

Condition of accessories: #1 Did not locate, #2 Did not locate, #3 Gone, #4 Gone, #5 Found in good condition, #6 Found in good condition, #7 Gone, #8 Gone, #9 Found in good condition, #10 Found in good condition.

**C. DESCRIPTION OF MONUMENT FOR CORNER AND ACCESSORIES ESTABLISHED TO PERPETUATE LOCATING THE POSITION OF THE CORNER:**

I accepted the 5" square concrete monument as a substantial marker for the corner and is accepted as a careful and faithful reestablishment of the position of the original corner.

- #5 14" White Oak N33°E 44.95' Found dock spike in Northwest face.  
 #6 18" White Oak N49°W 62.11' Found 60d spike in Northeast face.  
 #9 17" White Oak N21°W 30.96' Found dock spike in East face.  
 8" Black Oak S31°E 66.95' Set 60d spike in West face.

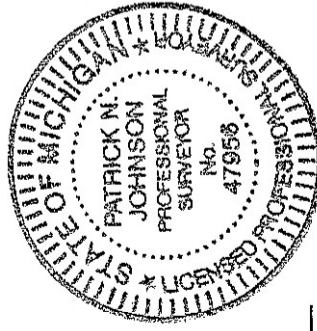

Signed by \_\_\_\_\_ Date 12-19-05

Patrick N. Johnson

Surveyor's Michigan License No. 47956