

JAN 25 2001

SECTION LAND CORNER RECORDATION CERTIFICATE
 FILING REQUIREMENT OF ACT 74, Mich. P.A. 1970

RECORDED
 LAKE COUNTY, MI.

LIBER004 PAGE 0257
 MAY 5 10 27 AM '00

Robert Wetherell
 REGISTER OF DEEDS

For corners in _____ Located in: _____ Corner Code# _____
 Lake _____

1. Public Land Survey T 18 N R 14 W G-10
 T R
 T R
 T R

2. Property Controlling S T R
 in Section T R

3. Miscellaneous S T R
 Property in Sec. T R

4. Lot No. _____ Recorded Plat _____
 5. Private Claims S T R

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2			6	5	4	3	2	1					
3													
4			7	8	9	10	11	12					
5													
6			18	17	16	15	14	13					
7													
8			19	20	21	22	23	24					
9													
10			30	29	28	27	26	25					
11													
12			31	32	33	34	35	36					
13													

I, Robert L. Wetherell, in a field survey on March 13, 2000, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by decree of a Court of Law and/or that the corner points mentioned in lines 3, 4, and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

G-10 - 1/4 Corner common to Sections 27 & 28, T18N, R14W

A. Description of original monument and accessories and/or subsequent restoration:

- 1838 - S. Sibley, G.L.O.
 #1 - 12" Pine N25°W 14 Links
 #2 14" Pine S34°E 11 Links
- 1919 - G.H. Johnson, Co. Sur.
 #3 - 10" B. Oak N25°W 35.0'
 #4 - 8" W. Oak N2°E 50 Links
- Undated C. Landon, Unlicensed Sur.
 #3 - 14" B. Oak N25°W 54 Links
 #4 - 8" W. Oak N2°E 50 Links
- 1964 - R.A. Griffin, L.S 5489
 L.C.R.C. - Liber 01, Pg. 116
 "Found 3/4" x 24" bar - replaced with a 5" Square Conc. Monument.
 #6 - 8" W. Oak S66°E 16.85'
 #8 - T. Pole S32°W 94.50'
 #5 - 12" W. Oak N43°W 10.95'
 #7 - Top center railroad rail S26°W 51.65'
- 1952 - G. Blass, L.S 5489
 "Set 3/4" x 24" Iron Bar by single proportionate method".
 #5 - 10" W. Oak N43°W 10.56'
 #6 - 6" W. Oak S66°E 16.78'
 #7 - N. Railroad Rail S26°W 51.47'


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I found Griffin's 5" Square Concrete Monument 55 feet more or less North of centerline of railroad tracks.
 Condition of the accessories are as follows: #1 Gone, #2 Gone, #3 Gone, #4 Gone, #5 Found in good condition, #6 Found in good condition, #7 Found in good condition, #8 Gone.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I accepted the 5" Square Concrete Monument as a substantial marker for the corner, and is accepted as a careful and faithful reestablishment of the position of the original corner.
 17" W. Oak N38°W 11.12' (60d spike in S.W. side) #5
 11" Tw. W. Oak S63°E 16.83' (dock spike in S. side) #6
 6" R. Pine N30°E 36.95' (60d spike in W. side)
 6" R. Pine S88°E 59.02' (60d spike in N. side)

WITNESSED BY ONE OF THE DEED REVIEW GROUP
 IN ACCORDANCE WITH P.A. 945
 CLERKMAN R. K. W.
 DATE 4-11-2000

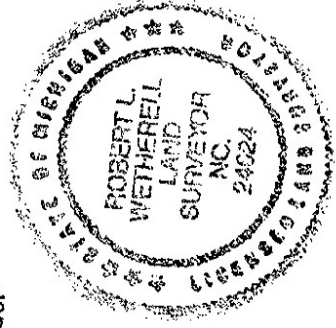

Signed by Robert L. Wetherell
 Surveyor's Michigan License No. 24624

Date April 12, 2000