

2132

1994 PRESQUE ISLE COUNTY STATE OF MICHIGAN REMONUMENTATION PRESQUE ISLE COUNTY RECORDED

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

9/4 SEP 12 AM 10:40

Janice M. Lambert REGISTER OF DEEDS

LIBER 311 PAGE 233

For corners in Presque Isle (County) Located In: Corner Code: # 1. Public Land Survey T 36N R 2E M-11 2. Property Controlling in Section S T R R R R 3. Miscellaneous Property in Sec. S T R R

Register of Deeds Stamp & File Number

4. Lot No. 5. Private Claims I. James A. Beck, in a field survey on July 13, 1994 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below: NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

Table with columns A-M and rows 2-13

A. Description of original monument and accessories and/or subsequent restoration:

M-11 1856: Original monumentation in Government Resurvey. Set post corner of Sections 25 & 36 and referenced: Aspen 12" N50W 27 Links W. Pine 12" S19W 21 Links Notes from survey (circa 1955) of Sec. 30, T36N, R3E by Doyle Engineering furnished by James Granger of Granger Associates Found 4" x 4" Cedar Stake Corner Recorded by Ronald R. Bischer, P.S. 22428, Nov. 8, 1979, Set 1/2" rod by single proportion on Township Line. Referenced: N28°E 46.87'; 6" Balsam S43°W 17.36'; 4" Maple N70°W 16.26'; 3" Maple


Ratified by Peer Group in accordance with P.A. 34 Chairman Delbert S. Pate Date August 29, 1994

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-11 1994: found a 2" pipe by extending line from corners M-9 (NE Corner Sec. 25) to M-10 (East 1/4 Corner Section 25) these being corners as noted by Doyle Engineering in work performed in Sec. 30, T36N, R3E, circa 1955. Corner was discovered after running traverse from SE Corner Sec. 25 (M-11 per 1979 recordation) to NE cor. (M-9) per 1975 recordation. Doubling back from iron pipe found at E 1/4 Cor (M-10) produced a 2" erect pipe with 4" x 4" rotted post prone upon the surface covered with humus adjacent to the corner. Southwest of corner approximately 13', a rotted pine stump was found, possibly original bearing tree. Computations of corner relative positions along Easterly line Sec. 25 using this corner are in near exactness to singular proportionate measure and alignment. This corner monument location is believed to represent and supercede corner recorded by R. Bischer referred to in above. Iron set by R. Bischer is used to perpetuate the position of the corner. A monument for corner and accessories established to locate the position of the corner.

C. Description of monument

M-11 1994: 1/2" iron rod and cap P.S. 21559 inside a 2" gas pipe with coupling. Witnesses: S23°W 13' (approx.) Rotted Pine Stump N18°W 18.19' 7" Maple\* S62°E 42.50' 3" Maple\* S03°E 10.00' 8" Stem of Twin 6"-8" Maple\* S85°W 21.56' 5" Maple\* N73°E 13.02' 1/2" Iron Rod (at previously recorded corner location) \* = Set tag P.S. 21559

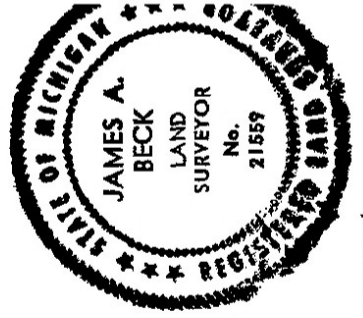

Signed by James A. Beck Date August 25, 1994