

Approved by Alger County
Land Survey Re-monumentation
Peer Group Under Act 343 of
P.A. of 1980 On 3-24-1997

Geoff Carlson
Chairman

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

5-37

For corners in ALGER (County)	Located In:	Corner Code #
1. Public Land Survey	T 48N R 15W	K8
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

FILED
TIME 2:00 p.m.

MAR 31 1997

DONALD W. KINNUNEN
REGISTER OF DEEDS
ALGER COUNTY, MI

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	N
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Robert L. Jamros, in a field survey on September 16, 1996, 19_____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

K8: PLS - George E. Adair, DS, 1851, Set quarter Section post * Sugar 18, N.27 E., 27 links * Sugar 15, S.27 W., 14 links **** T.J. McClaren, C.C.I.Co., Forestry Division, 4-22-54. * Set post from original Maple BT (stump). Sugar 15, S.27 W., 14 links. * Established the following bearing trees, Red Maple 10", N.48 E., 19.8 feet and Red Maple 6", N.47 W., 19.4 feet. **** No other subsequent restoration.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

K8: Found post (down) of the 1954 report and a 3/4" iron rod, badly bent. * BT's of the 1954 report were found green and standing. * Red Maple 6", N.47 W., 19.4 feet and Red Maple 10", N.48 E., 19.8 feet. * At S.27 W., 14 links from downed post found stub of original Maple BT with center decayed and hollow. * Also found remains of post point at measured location, installed new monument at the point location. * Monument as established is accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

K8: Set Berntsen Monument No. A1NB30, stamped to identify corner position. Renewed existing reference trees w/ BT signs and paint. Established additional reference trees w/ BT signs, blazed, scribed and painted. Set PK nails for measure w/ Alum. I.D. washers in the following reference trees. * Spruce 20", S.36 W., 20.22 feet, "1/4S BT". * Exist. BT, Maple 12", N.47 W., 20.47 feet, "1/4S BT", * Exist. BT, N.53 E., 20.69 feet, "1/4S BT". * Maple 8", S.25 E., 40.64 feet, "1/4S BT". * Survey marker sign on six foot steel post, South, 0.90 feet. * All bearings are magnetic.

Signed by


Robert L. Jamros

Date

25 March, 1997

Surveyor's Michigan License No.

25489

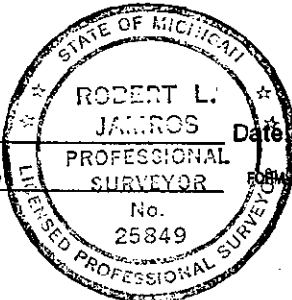

APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 25, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983