

SURVEY & REMONUMENTATION

FEB 19 1998

Approved by Alger County
Land Survey Remonumentation
Peer Group Under Act 945 of
P.A. of 1990 On 12-10-1997

05-76

SECTION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in _____
(County)

Located In: _____ Corner Code # _____

FILED
TIME 8:30 A.M.

DEC 17 1997

DONALD W. KINNUNEN
REGISTER OF DEEDS
ALGER COUNTY, MI

Register of Deeds Stamp & File Number

1. Public Land Survey	T	<u>49</u>	R	<u>13</u>	<u>J5</u>
	T	_____	R	_____	_____
	T	_____	R	_____	_____
	T	_____	R	_____	_____
2. Property Controlling in Section	S	_____	T	_____	R
	S	_____	T	_____	R
3. Miscellaneous Property in Section	S	_____	T	_____	R
	S	_____	T	_____	R

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5									●			
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, Robert L. Jamros, in a field survey on November 20, 1997, 19_____, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:


J5: PLS - Francis Colman, DS, 1951 * Set quarter section post * Maple 19, N.32 E., 32 links * Sugar 10, S.49 W., 14 links **** J.R. Radcliffe, RLS, C.C.I. Co., Land and Timber Report, 1957 * Down BT and post * Unrecorded **** No other subsequent restoration on record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

J5: Established corner position by field survey * Found 2 inch squared cruisers post, N.71 E., 18 feet, and evidence of down BT not found * Blazes and paint found in cardinal directions from cruisers post * Corner position established on true line at mid point between section corners * Corner position is accepted as a careful and faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

J5: Set Berntsen Alum. monument no. A1NB30, stamped to identify corner position * Established reference trees with BT signs, blazed and scribed * Set PK nails w/Alum. I.D. washers for measure at the following * Maple 7, S.10 E., 7.75 feet, 'BT' * Maple 12, N.35 E., 26.9 feet, 'BT' * Maple 3, N.56 W., 30.16 feet, 'BT' * Spruce 6, S.77 W., 25.0 feet, 'BT' * Survey marker sign on 6 foot steel post, N.30 W., 1.7 feet * All bearings are magnetic.

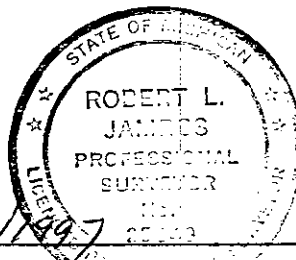

Signed by Robert L. Jamros
Surveyor's Michigan License No. 25849

Date 12/10/1997