

APR 29 1999

SECTION

ALLEGAN COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Allegan (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>3</u> N R <u>14</u> W	E-3
	T ___ R ___	Heath Twp.
	T ___ R ___	
	T ___ R ___	
2. Property Controlling in Section	S ___ T ___ R ___	
	S ___ T ___ R ___	
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	
	S ___ T ___ R ___	


FILED
1/28/1999 2:44:39 PM
JOYCE A. WATTS
REGISTER OF DEEDS
ALLEGAN COUNTY, MICH
Register of Deeds Stamp & File Number

LIBERO 006 PAGE 19

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Kirk L. Van Order, in a field survey on Mar. 5, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

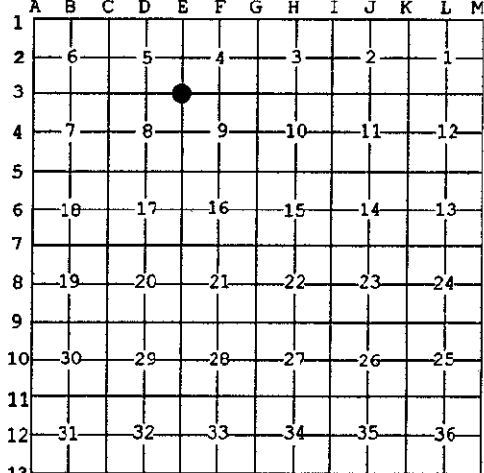

A. Description of original monument and accessories and/or subsequent restoration:
E-3
(1) GLO Calvin Britain D.S. 1831
North between Sections 8 & 9
80.00 ch. set post corner Sections 4, 5, 8 & 9
Elm 9" dia. S84°E 14 links
Maple 7" dia. N87-1/2°W 24 links

APPROVED REMONUMENTATION CORNER
P.A. 345 OF 1990
ALLEGAN COUNTY
DATE APPROVED MARCH 10, 1998
COUNTY REP. [Signature]

(continued on back of sheet)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
Fd. capped iron & 3/4" x 10" iron in mon. box (false corner - Note: dist. capped iron in out of mon. box) with the following witnesses:
SW corner house NE 89.00'
Power pole SE 80.00'
Power pole SW 70.30' (measured 70.38' to fd. PK nail in NW side power pole)
And accepted found capped iron as a careful and faithful perpetuation of the position of the original corner.
Peer group approved March 10, 1998.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
E-3
Removed capped iron & false corner iron in mon. box & removed mon. box. Set standard Allegan Co. Remon. monument (3/4" x 24" steel rod w/red cap #23520)
SW corner house fndn. AZ 35° 89.00'
Nail & Remon. tag in NW side 27" Maple AZ 30° 69.95'
Nail & Remon. tag in SE side power pole AZ 55° 62.30'
Nail & Remon. tag in NE side power pole AZ 155° 80.00'
Nail & Remon. tag in SE side power pole AZ 215° 70.37'

Signed by [Signature]
Surveyor's Michigan License No. 23520

Date 12-23-98



APR 29 1993

SECTION

Section A (continued from Page 1)E-3Heath Twp., T.3N., R.14W.

- (2) LCRC recorded in L. 1, P. 377 Donald A. Ratekin July 28, 1972
Part "A"

Stake & stone		
Basswood	SW	34.4'
Maple	NE	128'
1/2" iron	1969	
Gas vent	NW	30.45'
SW cor. house	NE	89.00'
P. pole	SE	80.00'
P. pole	SW	70.30'

Part "C"

Fd. 1/2" iron		
Gas vent	N40°W	30.45'
SW cor. house	N40°E	89.00'
P. pole	S40°E	80.00'
P. pole	S40°W	70.30'

- (3) LCRC recorded in L. 2, P. 75 Donald A. Ratekin Dec. 15, 1972
Same as recorded in L. 1, P. 377

- (4) Holland Engineering, Inc. (same as L. 1, P. 377)

- (5) Kirk L. Van order survey dated April 6, 1993

Set capped iron		
SW cor. house	NE	89.00'
PK in power pole	SE	80.00'
PK in S. side power pole	NE	61.96'
Power pole	SW	70.30'