

MAR 16 1994

Allegan County Remonumentation  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
COMMISSION

Allegan  
(County)

Located in:  
Leighton Twp.

Corner Code #

- 1. Public Land Survey T 4N R 11W C-1
- T \_\_\_\_\_ R \_\_\_\_\_
- T \_\_\_\_\_ R \_\_\_\_\_
- T \_\_\_\_\_ R \_\_\_\_\_
- 2. Property Controlling S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- in Section S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- 3. Miscellaneous S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_
- Property in Sec. S \_\_\_\_\_ T \_\_\_\_\_ R \_\_\_\_\_

1993 DEC 30 PM 2:42  
 REGISTER OF DEEDS  
 ALLEGAN COUNTY, MICH.  
 Roger A. Blotto

FILED

Register of Deeds Stamp & File Number

- 4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
- 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	10	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Robert Jonker, in a field survey on October 25, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O. jog 54 links, 35.64' LCRC rec. in L. 3, P. 365  
 LCRC rec. in L. 3, P. 150 Ed Glaza Jr., 1983, Fd. PK nail per C.P. Co. wit.  
 Bonnema, Fd. boat spk, 1976, T. iron East 35.64'  
 per prev. wit. 5" W. Cherry N 20° W 44.19'  
 Nail, side 10" Poplar ENE 37.91' 6" Ash S 70° W 22.9'  
 Nail, side 8" Ash SW 22.91'  
 Nail, side 10" Cherry NNW 44.17'  
 T. iron East 35.58'


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found spike in mon. box, did not accept.  
 Reset corner on twp. line 35.64' West of the Kent Co. corner  
 1976 & 1983 wit. are out due to road construction.

Accepted as the best available evidence of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 3/4"x24" standard capped Barry Co. Monument  
 Harrison monument East 35.64'  
 Set N&T W'ly side 9" Poplar Az. 74°, 46.14'  
 Set N&T S'ly side 12" Ash Az. 278°, 99.33'  
 Set N&T NE side 4" Oak Az. 337°, 100.84'  
 Spike in mon. box, 0.18' E & 0.33' N  
 C/L N-S pavt. East 8 1/2' ±  
 B-1, West 2665.64'

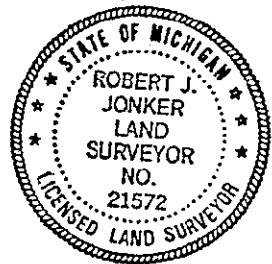

Signed by Robert J. Jonker Date 12-29-93  
 JONKER LAND SURVEYS  
 Surveyor's Michigan License No. 21572

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28, 1971  
 REVISED MAY 14, 1975  
 REVISED JAN., 1982