

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 30 N. R. 7 W.	I-2; I-3; K-2
2. PROPERTY CONTROLLING IN SECTION _____	2, T. 30 N. R. 7 W.	3
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on July 22, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A - Description of original monument and accessories and for subsequent restoration:

C. (continued) 3
 Fd. 1 1/4" iron pin surrounded by stones & set cedar post w/loc. tag
 8" Maple S26°E 14.73
 4" Balsam N74°E 27.80
 Center of irreg. N-S gravel rd.
 Due W 20'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- I-2 Accepted 3/4" pin as shown to F. Wagenschutz by Mr. Skinkle in May 1966. Corner fits U.S. tie to springs S 3 chains. Believed to be corner as recovered and monumented by F. Church, in 1909 & 1911. Irregular fence remains N-W & E.
- I-3 Accepted co. mon. along side buggy axle as recovered & remonumented by T. Miller April 1966. Corner fits survey of Sec. 3, F. Church, 1909 & 1911.
- K-2 Restored 1/4 cor. common to Sec. 1 & 2 T30N-R7W on line between the NW & SW corners of Sec. 1 & at record U.S. distance S of third correction line. This fits F.Church distance S from 1/4 corner to SW Sec. 1 very close. Church survey of S 1/2 of Sec. 1 in 1909.
- 3 Accepted 1 1/2" pipe surrounded by stones as shown to Wagenschutz by Skinkle in May 1966.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-2 Fd. 3/4" iron pin & set cedar post w/loc. tag 5" Maple N25°W 19.3 9" Maple S40°W 24.4 6" Maple S80°W 24.8 5" Maple N72°W 24.3	I-3 Fd. Co. mon. (3" alum. cap on 1" pipe) & set ced. post w/loc. tag *7" Cedar N38°W 16.5 *9" Ash N55°W 2.6 14" Tw. Cedar S43°W 31.4 6' Stream C-E Due N 30' *(Miller witness)	K-2 Set DNR mon. & cedar post w/loc. tag 18" Cedar N22°E 32.1 9" Hemlock N80°E 18.8 8" Hemlock S22°E 18.0 7" Cedar S88°W 23.2 Corner falls in roots of 20" elm stump
--	---	--


SIGNED BY Carl F. Roser 9-15-76 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

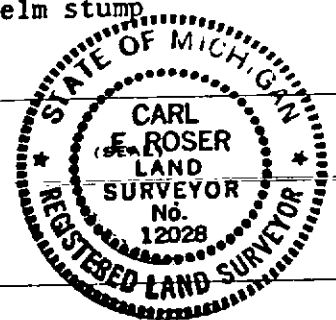

KEARNEY TOWNSHIP
ANTRIM COUNTY

SURVEYOR'S MICHIGAN REGISTRATION NO. _____