

SURVEY & REMONUMENTATION

MAR 05 1998

**ARENAC COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE**
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in SECTION _____

Arenac _____
(County)

Located In:

Corner Code

Page 1 of 1

LC 2 / 128

ROSE SMITH
ARENAC CO. REG. OF DEEDS
RS Rec. Date 12/23/97 Time 11:37
RECORDING FEES: 9.00

- 1. Public Land Survey T 18N R 4E M-5
T 18N R 5E A-5
T _____ R _____
T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, MICHAEL J. MACDONALD, in a field survey on OCTOBER 23, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-5
1. ORIGINAL POST SET IN JULY 1843, J. BURT D.S.
PINE 20" N 25" W 3 LKS.
ASPEN 18" S 61" W 15 LKS.

CORNER IS COMMON WITH A-5, T18N, R5E
 2. COUNTY SURVEY NOTES JULY 1911, FOUND POST
 3. SURVEY, L. 1, P. 316, GOSS(1977), FOUND MON
N 10° W 34.3 TO TP,
S30 °E 99.4' TO 18" WILLOW
S 25° W 58.10' TO 10" CEDAR
 4. SURVEY, L.1, P. 313, GOSS(1977), FOUND MON
N 10° W 34.3 TO TP
S30 °E 99.4' TO 18" WILLOW
S 25° W 58.10' TO 10" CEDAR
 5. EDMANDS ENG. BRIDGE ALIGNMENT PLANS FOR ARENAC CO. ROAD CO.(1983)
 6. SURVEY, L. 2, P. 43, MEYERS(1993), FOUND 3/8" REROD
S 45°E, 41.4' TO N/T IN FENCE POST, S 15°W, 58.60' N/T IN 16" CEDAR
N 35 °E, 41.80' TO N/T IN FENCE POST, N 35°W, 79.90' N/T IN 8" CEDAR
 7. SURVEY, L.2, P119, CIOSEK, 1995, FND 3/8" REROD
S 20° W 58.65' MDOT TAG E FACE 14" CEDAR
S 55° W 110.50' N/T NW FACE UP
N 35° W 79.84' N/T #9433 W. FACE FENCE POST
S 50° E 41.43' MDOT TAG NE FACE FENCE POST

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


M-5
FOUND A 3/8" IRON PER WITNESSES FROM SURVEY L.2, P119. EXCAVATED THE AREA AND FOUND NO OTHER OBJECTS IN THE AREA. ACCEPTED THE 3/8" IRON AS THE BEST AVAILABLE EVIDENCE OF THE LOCATION OF THE ORIGINAL CORNER.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-5
REPLACED 3/8" IRON WITH 5/8" x 24" REROD WITH ARENAC CO. REMONUMENTATION CAP.
S 20° W 58.55'(58.65' R.) MDOT TAG E FACE 14" CEDAR
S 55° W 110.58' (110.50' R.) N/T NW FACE UP
N 35° W 80.22' (79.84' R.) N/T #9433 W. FACE FENCE POST
N 35° E 41.75' (41.67' R.) N/T #9433 W. FACE FENCE POST
S 50° E 41.45' (41.43' R.) MDOT TAG NE FACE FENCE POST

ACCEPTED BY THIS ARENAC COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990, AT 'A' MEETING HELD ON 10/30/97
Paul M. Ciosek
PAUL M. CIOSEK P.S., CHAIRMAN

Signed by Michael J. MacDonald
Surveyor's Michigan License No. 22438

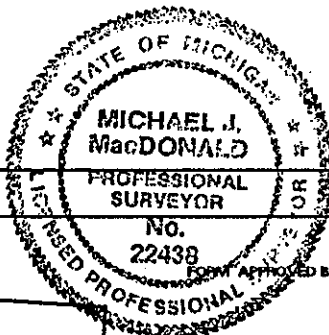

Date 22 Dec 97

FIELDBOOK #2, P AGE 50

PAUL M. CIOSEK P.S., CHAIRMAN
345 OF 1990 AT 'A' MEETING HELD ON