


LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In:			
Arenac _____	Located In	Corner Code #	
(County)			
1. Public Land Survey	T 19N R 3E	E2	
	T _____ R _____	_____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____	_____
	S _____ T _____ R _____	_____	_____
3. Miscellaneous Property in Section	S _____ T _____ R _____	_____	_____
	S _____ T _____ R _____	_____	_____
4. Lot No: _____	Recorded Plat: _____		
5. Private Claims: _____			

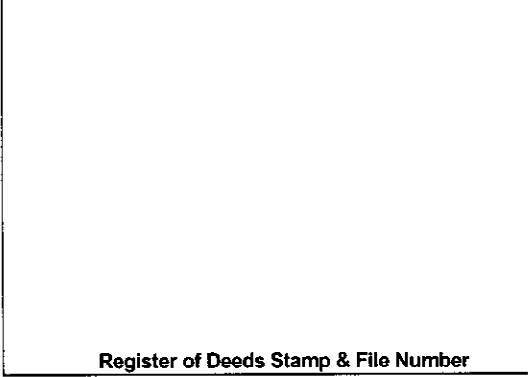

I, Craig W. McVean, in a field survey on Aug. 29, 2005 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5	●	4		3		2		1	
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

E2 - GLO - Set 1/4 Post - J. Mullett - 1846
 W. Pine 6" S79°W 45 L.
 W. Pine 4" N67°E 33 L.
 - CCC Notes - 1930's - North random 120 CH - Random post set.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

E2 - 1/4 Corner common to Sec. 4 & 5 - No GLO or corner evidence found. Set 4" DNR Alum. Cap on 1" x 4' long galv. iron pipe by single proportion to GLO between fd. 'E1' and re-established 'E3'. Swampy ground. DNR Mon. accepted as a careful and faithful re-establishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

E2 - 4" DNR Alum. Cap on 1" x 4' long galv. iron pipe.
 N34°W 28.78' to set 1/2" x 15" rebar
 N51°E 32.37' to set 24" long 'T' iron
 S58°W 21.56' to set N & T in N. side 10" Ash
 S10°W 19.36' to set N & T in E. side 4" Ash
 Set Blue Carsonite Post 1' N.



Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 9/22/2005