

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Baraga  
 (County)

Located In: Corner Code #

1. Public Land Survey	T <u>47N</u> R <u>34W</u>	<u>K12</u>
	T <u>   </u> R <u>   </u>	<u>   </u>
	T <u>   </u> R <u>   </u>	<u>   </u>
	T <u>   </u> R <u>   </u>	<u>   </u>
2. Property Controlling in Section	S <u>26</u> T <u>47N</u> R <u>34W</u>	<u>14</u>
	S <u>   </u> T <u>   </u> R <u>   </u>	<u>   </u>
3. Miscellaneous Property in Sec.	S <u>   </u> T <u>   </u> R <u>   </u>	<u>   </u>
	S <u>   </u> T <u>   </u> R <u>   </u>	<u>   </u>

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

Aug 13 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

**A. Description of original monument and accessories and/or subsequent restoration:**


(K12) Quarter corner common to Sections 35-36. 1852: Established by Z.B.Searles midway between Section corners 40.03 chains north and south. Set wood post. Spruce 10 S46E 23L, Y.Birch 4 N40 1/2W 33L. 1966: Monument placed by Billy D. Buckler RLS at "an old wood post. Found no evidence of original witnesses". 1" pipe with 4" aluminum cap. 9" Soft Maple N15W 26.6', 11" Soft Maple S88E 27.5'. (14-Sec. 26) South 1/16 corner between Sections 25-26. Not established in the original survey.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(K12) The original post and accessories were not recovered. Found the 1966 monument as described, at record bearing and distance from the 1966 witnesses. Determined that the 1966 monument is N77W 119.2' from the position subsequently monumented. The original survey of this part of the township seems to have been faithfully executed and no evidence on the ground or in the record was found to satisfactorily explain the discrepancy in the corner location. Therefore I reject the 1966 position, remove the monument, and reestablish the corner proportionate to the US record, on a line of mean true bearing between Section corners 2635.57' north and south. (14-Sec. 26) Established the corner midway and on a line of mean true bearing between Section corner 1317.75' south and Quarter corner 1317.75' north. The monument leans slightly NW due to rocky ground. Measurements shown below are to the center mark on the monument tablet, which is at the corner position.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(K12) 1" IDx32" iron pipe with 4" alum.	(14) 1" IDx32" iron pipe with 4" alum.
MDNR tablet. Blazed and scribed:	MDNR tablet. Blazed and scribed:
8" Sugar N56E 17.5'      "1/4S NBT"	8" Sugar N38E 12.3'      "1/16S BT"
16" Sugar S79E 7.9'      do	10" Cedar S66E 32.6'      do
6" Spruce S79W 7.4'      do	13" Sugar S34W 11.3'      do
12" Sugar N59W 21.2'      do	12" Cedar N39W 28.5'      do
Squared sugar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.	Bearings are magnetic. Distances to notch in lower blaze.

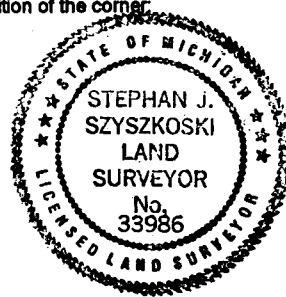

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 10/24/01

For the Michigan Department of Natural Resources - Office of Property Management