

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Baraga

(County)

Located in:

Corner Code #

1. Public Land Survey	T	48N	R	32W	E7
	T	48N	R	32W	F7
	T		R		
	T		R		
	T		R		
2. Property Controlling in Section	S		T	R	
	S		T	R	
3. Miscellaneous Property in Sec.	S		T	R	
	S		T	R	

Register of Deeds Stamp &amp; File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

F7 Apr 27 1998

E7 Apr 30 1998

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

**A. Description of original monument and accessories and/or subsequent restoration:**

(E7) Corner common to Sections 16-17-20-21. Corner perpetuated in 1960 by Neal Spherake, RLS, at the original position. 1" x 36" galvanized iron pipe with aluminum Kimberly-Clark Corporation cap. Maple 7 N12E 78 links, Maple 12 N30W 91 links, Maple 8 S46W 61 links, Maple 12 S24E 26.5 links. Corner recovered by the undersigned in 1993 in accord with the record above and used to control a subdivision of Section 20.

(F7) Quarter corner common to Sections 16-21. Corner established in 1852 by Guy H. Carleton: "40.00 Set Quarter Post Cedar 12 N35E 20 links, Spruce 6 S78E 22 links". Found no subsequent record.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(E7) Recovered the 1960 monument as described, in good condition, and at record bearing and distance from all four 1960 witnesses. All are still living except the Maple NW which is dead but standing. Left the monument in place and marked one new accessory as described below. Corner recovered and re-witnessed by D. Lampela and B. Wheeler, Baraga District Office.

(F7) Original corner post not recovered. Reestablished the corner from the remains of two stumps - probably the original bearing trees - of proper size and species, and both at record bearing and distance. No markings were found on either, as they are well rotted with solid wood found only in the interior. Two probable original corners are 2616.71' West and 2626.36' East. This corner lies about 9.8' north of a straight line between. At the position for the corner, I placed a 1" I.D. x 5.5' long iron pipe capped with a 4" dia. cast aluminum MDNR tablet, appropriately stamped. Corner placed and witnessed by D. Lampela and B. Wheeler, Baraga District Office.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(E7) Found 1" pipe with 4" Kimberly-Clark Corporation cap. Blazed and scribed the following:

20" Y. Birch N51W 10.6' "S17 NBT"

Recovered the 1960 witnesses:

11" Maple N16E 51.5' "S16 NBT"

11" Maple S49W 40.3' "S20 NBT"

15" Maple S23E 17.5' "S21 NBT"

A 6" squared Balsam is N60E 3.85'

Bearings are magnetic. Distances are to notch in lower blaze.

(F7) Set 1" pipe with 4" MDNR cap.

Blazed and scribed the following:

8" Cedar N81E 33.0' "1/4S NBT"

12" Cedar S79E 53.9' "1/4S NBT"

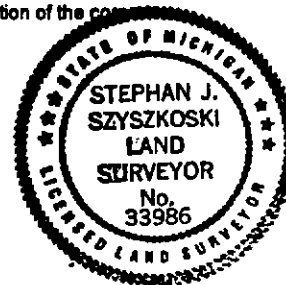
5" Cedar S20W 28.7' "1/4S NBT"

5" Cedar N50W 7.6' "1/4S NBT"

Bearings are magnetic. Distances are to

notch in lower blaze. Placed a squared

balsam post adjacent.

Signed by Stephan J. SzyszkoskiDate 6/10/98Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division