

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Baraga <small>(County)</small>	Located In:	Corner Code #
1. Public Land Survey	T 48N R 32W	E6
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	



4. Lot No. _____ . Recorded Plat _____
5. Private Claims _____

Apr 23 1998

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

(E6) Quarter corner common to Sections 17-16. Corner reestablished by single proportionate measurement in 1978 by Keith L. Sackett. 1" ID x 36" iron pipe with aluminum cap. 6" Spruce N46N 27.0', 5" Spruce N39E 5.0', P.Pole 201 S36E 53.2'.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(E6) Recovered the 1978 monument as described, a 1" ID iron pipe capped with a 4" dia. cast aluminum State of Michigan tablet, set very loosely in a rock mound. One of the 1978 Spruce NBTs has been cut. Also I was not able to determine the measuring mark on the P.Pole noted as a witness in 1978 and was not able to accurately position the corner from the 1978 witnesses. As I have surveyed to adjacent section corners this date, I reestablished the corner according to the 1978 method: midway and on a line between section corners to the north and south. I reset the 1978 monument at this position and made firm in a mound of rock and concrete 3' in dia. and about 1.5' high. Made new witnesses as described below. Corner placed and witnessed by B.Wheeler and D.Lampela, Baraga District Office.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(E6) Set 1" pipe with 4" aluminum cap.

Blazed and scribed the following:

3" Balsam N60W 26.75' 1/4S NBT

5" Balsam N60E 7.85' 1/4S NBT

Set PK/washer in NW face power pole S35E

54.0', Set PK/washer in SW face power

pole S26E 65.9'. The PK nails are at

approx. waist height. Distances to the


PK's are slope distances. Brg's. are

magnetic. Dist. to trees are to notch

in lower blaze. Placed post adjacent.

Signed by Stephan J. Szyszkoski
Surveyor's Michigan License No. 33986

Date 6/10/98

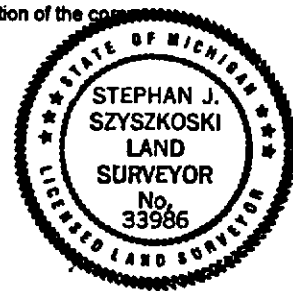

For the Michigan Department of Natural Resources - Forest Management Division