

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Baraga	Located In:	Corner Code #
<small>(County)</small>		
1. Public Land Survey	T 49N R 34W	D7
	T 49N R 34W	C7
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

May 03 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7		●	●									
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												


**A. Description of original monument and accessories and/or subsequent restoration:**  
 (D7) Quarter corner common to Sections 17-20. Reestablished midway and on line between section corners in 1959 by Billy D. Buckler RLS. 1" pipe with 4" brass cap. 7" J.Pine S69E 6.5 links, 8" J.Pine N83W 18.5 links.  
 (C7) Corner common to Sections 17-18-19-20. Reestablished by single proportionate measurement in 1958 by Billy D. Buckler RLS. 1" pipe with 4" brass cap. 8" J.Pine N84W 19 links, 8" J.Pine S45E 23 links, 8" J.Pine N38E 45 links.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

(D7) Recovered the 1959 monument at record bearing and distance from the remains of the 1959 NBTs. The J.Pine SE is a low-cut stump with no markings visible. The J.Pine NW is a decayed stump. Left the monument in place and made new witnesses as described below.  
 (C7) Recovered the 1958 monument, in good condition, set firmly, at record bearing and distance from the remaining two NBTs, the J.Pines NW and NE. The NW is a standing stub, and the NE is dead and down with the stump in advanced stages of decay. A scribed "S" is still visible on the trunk. Left the monument in place and made new witnesses.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(D7) Found 1" ID iron pipe with 4" brass MDOC cap. Blazed and scribed:	(C7) Found 1" ID iron pipe with 4" brass MDOC cap. Blazed and scribed:
10" J.Pine N40W 15.9'      "1/4S NBT"	6" J.Pine N44W 6.0'      "S18 NBT"
4" J.Pine N74W 23.3'      do	6" J.Pine N76E 28.1'      "S17 NBT"
5" J.Pine S10W 32.6'      do	7" J.Pine S52E 8.8'      "S20 NBT"
3" Maple S58E 66.3'      do	3" J.Pine S60W 28.3'      "S19 NBT"
Bearings are magnetic. Distances are to notch in lower blaze.	Bearings are magnetic. Distances are to notch in lower blaze.

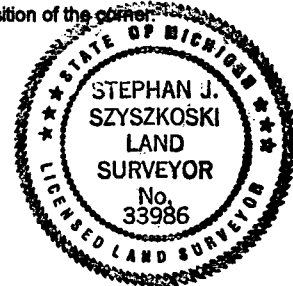

Signed by Stephan J. Szyszkoski Date 8/15/01  
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division