

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Baraga
 (County)

Located In: _____ Corner Code # _____

- | | | | | | |
|------------------------------------|---|------------|---|------------|-------|
| 1. Public Land Survey | T | <u>49N</u> | R | <u>34W</u> | C1 |
| | T | <u>49N</u> | R | <u>34W</u> | E1 |
| 2. Property Controlling in Section | S | _____ | T | _____ | _____ |
| | S | _____ | T | _____ | _____ |
| 3. Miscellaneous Property in Sec. | S | _____ | T | _____ | _____ |
| | S | _____ | T | _____ | _____ |

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Feb 01 2000

I, Stephan J. Szyszkoski, in a field survey on _____, 19____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	10		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


A. Description of original monument and accessories and/or subsequent restoration:
 (C1) Corner common to Sections 5-6 T49N-R34W and 31-32 T50N-R34W. Remonumented in 1958 by Billy D. Buckler, RLS, in the original position. 1" pipe with 4" brass cap. 36" White Pine stump S88E 48 links, 36" White Pine stump N57W 40.5 links.
 (E1) Corner common to Sections 4-5 T49N-R34W and 32-33 T50N-R34W. Remonumented in 1950 by Billy D. Buckler, RLS, in the original position. 1" pipe with 4" brass cap. 9" Red Pine S10W 43 links, 40" Pine stump S54W 28 links, 8" Poplar N52W 39 links, 12" J.Pine N7W 40 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(C1) Found the 1958 monument, a 1" ID iron pipe capped with a 4" dia. brass Michigan Dept. of Conservation tablet, in good condition and at record bearing and distance from the remains of the 1958 witnesses. Left the monument in place and made new witnesses as described below.
 (E1) Recovered the 1950 monument, a 1" ID iron pipe capped with a 4" brass Michigan Dept. of Conservation tablet, in good condition and at record bearing and distance from the R.Pine NBT, found in good condition, and from the remains of the 40" Pine stump. The Poplar and J.Pine NBTs were not recovered. Left the monument in place and made new witnesses.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corners:

(C1) Found 1" ID iron pipe with 4" brass cap. Blazed and scribed: 11" Oak S31E 6.0' "S5 NBT" 11" W.Pine S28W 35.0' "S6 NBT" 8" W.Pine S80W 64.1' "S6 NBT" 3" W.Pine North 18.7' "S31 NBT" Sq'd sugar post adjacent. Bearings are magnetic. Distances to notch in lower blaze.	(E1) Found 1" ID pipe with 4" brass cap. Blazed and scribed: 19" R.Pine S16W 28.4' (the 1950 NBT - did not make new markings) 14" W.Pine S65W 8.1' "S5 NBT" 11" W.Pine N47W 29.3' "S32 NBT" 11" W.Pine N52E 23.7' "S33 NBT" Set sq'd W.Pine post adjacent. Bearings magnetic. Dist. to notch in lower blaze.
----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------

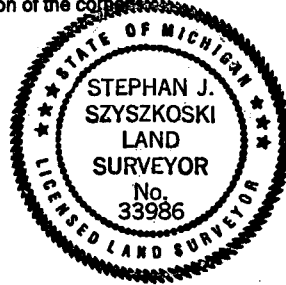

Signed by Stephan J. Szyszkoski Date 5/2/01
 Surveyor's Michigan License No. 33986

For the Michigan Department of Natural Resources - Forest Management Division