


APR 0 8 1996

COMMISSION For corners in	Filing Requirer	ment of Act 74, Mich.	P.A. 1970					
Baraga (County)	Located In:	Corner Code # E-1	OF D	IVED FOF ECEMBER RECORDED	A.D. 19	995 AT	10:30	O AM
Public Land Survey	T 50N R 31W T R R T R R		579	ER RECOF - 580.				
	TR TR		BARA	GA COUN	Y REGIS	llar.	FDFFI	<u> </u>
3. Miscellaneous S	TR			ister of De				
4. Lot No, Record 5. Private Claims				A 8	C D &	F G H	+ †	K L
	W.			3	54	3-	1 1	 1-
Michael Mileski	eld survey on	ber , 19	95	4 - 7 -	-8	10		12-
as expressed below: NOTE: Not more than 4 corners, on this certificate. A. Description of original monus E-1; Closing Corner comr	ment and accessories an	d/or subsequent restora		12 -31 -13	32 3		35	36-
See back of form.		OVED LAND CORNER P.A. 345 OF 1990 Baraga County 12-19-95						
B. Description of corner evidence	ce found and/or method	applied in restoring or re	eestablishing	corner:				
E-1; Closing Corner comr	non to Sections 4 a	nd 5, T50N, R31W	'.					
See back of form.								

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- E-1; Closing Corner common to Sections 4 and 5, T50N, R31W.

See back of form.

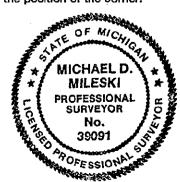

Signed by	Lastorill	inde lill	
Surveyor's M	ichigan License No	39091	

- A. Description of original monument and accessories and/or subsequent restoration:
 - E-1; Closing Corner common to Sections 4 and 5, T50N, R31W.

Originally established during U.S. Survey conducted by Guy Carleton, D.S. in 1852 and monumented with a wood post witnessed by a

Hemlock 10 S20°W 78 lks. (Gone)

and a

Hemlock 30 S50°E 52 lks.

(Recovered as a severely decayed 15" tall stump approximately 30" in dia. having no visible marks from which a 6 foot section of fallen trunk bears S35°E.)

The late Norman Thompson, RLS #4348 states in his field notes of T51N, R31W dated 12 November 1943 (copies of which were obtained from the Northern Hardwoods' office in L'Anse) that he reestablished this corner by measurement from the south one-quarter corner of Section 35, T51N, R31W. Mr. Thompson set a hemlock post and noted the following new bearing trees:

Sugar Maple 4 N25°E 15.5'

and a

Hemlock 7 N47°W 31.2'

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 - E-1; Closing Corner common to Sections 4 and 5, T50N, R31W.

Found a 2" iron pipe projecting 12" above ground alongside of which is a scribed square wood post firmly set projecting 24" above ground apparently set by Mr. Thompson. I reestablished this corner from the remains of what I believe to be the southeast U.S. bearing tree. Refer to Part A. This position is located 788.0 feet (U.S. = 785.40 feet) easterly of the south one-quarter corner of Section 35, T51N, R31W, which is an original U.S. corner. The easterly bank of the Slate River (meas. 40' wide, U.S. = 39.6' wide) is located 38 feet (U.S. = 92.4') west of this position. Accepted as the best available evidence of the position of the original corner.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 - E-1: Closing Corner common to Sections 4 and 5, T50N, R31W.

Set 1" (I.D.) x 36" galvanized iron pipe with 2" aluminum cap appropriately stamped as to location from the probable remains of the southeast U.S. bearing tree.

Set 60d spike	W/side	10" Hemlock	N23°E	16.01'
Set 60d spike	N/side	12" Hemlock	N83°E	21.23'
Set 60d spike	W/side	14" Hemlock	S10°E	14.38'
Set 60d spike	SE/side	14" Hemlock	S60°W	29.00'

All of the above new bearing trees are marked with upper and lower face blazes and scribed "NBT".