

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>51</u> N. <u>34</u> E. <u>W.</u> S. R. <u>34</u>	<u>G9, G10</u>
2. PROPERTY CONTROLLING IN SECTION <u>28</u>	T. <u>51</u> N. <u>34</u> E. <u>W.</u> S. R. <u>34</u>	<u>14</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. _____ S. R. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Keith L. Sackett, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner G9: Original Monument and Accessories Not Found. Found 1 1/4" iron pipe in N-S county road in line with fences east and west. Pipe was previously witnessed by G. G. Neault.

Corner G10: Original Monument and Accessories Not Found.

Corner 14: Not Set on Original Survey Nor Subsequently Apparently. Found old wood post 80 ft. north. It may have been used as corner or possibly a right of way marker.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner G9: Restored 10/19/78 at pipe.

Corner G10: Restored 10/20/78 on line and midway between section corners north and south.

Corner 14: Established 10/20/78 on line and midway between section corner south and 1/4 corner north.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner G9: 1 1/4" by unknown length Iron Pipe buried in County road. Reference tag and nail in:
9" Spruce N82W 27.79 ft.
7" Apple S51W 42.60 ft.
11" Hemlock S86E 55.81 ft.

Power Pole N71E 55.43 ft.
4" Cherry N52W 27.37 ft.

Corner G10: Set 1" I.D. x 24" Iron Pipe with 4" aluminum cap in NW corner of road int. Road int. S48E 30 ft. Reference tag and nail in:

Corner 14: Set 1" I.D. x 36" Iron Pipe with 4" aluminum cap in back slope of highway 45 ft. north of Center Line.
9" Sugar N07E 26.3 ft. 1/16S, BT
12" Y. Birch N50W 31.0 ft. 1/16S, BT

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Keith L. Sackett
CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR
 Keith L. Sackett
 Department of Natural Resources

DATE October 1978

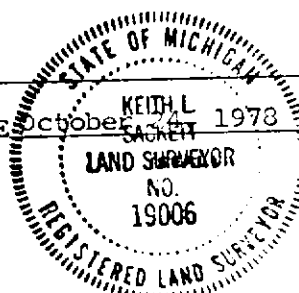

SURVEYOR'S MICHIGAN REGISTRATION NO. 19006