

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in


Baraga

(County)

Located In:

Corner Code #

- | | | | |
|---------------------------------------|------------|---------------------------|----------|
| 1. Public Land Survey | T | R | _____ |
| | T | R | _____ |
| | T | R | _____ |
| | T | R | _____ |
| 2. Property Controlling
in Section | S <u>1</u> | T <u>51N</u> R <u>34W</u> | <u>3</u> |
| | S | T | R |
| 3. Miscellaneous
Property in Sec. | S | T | R |
| | S | T | R |

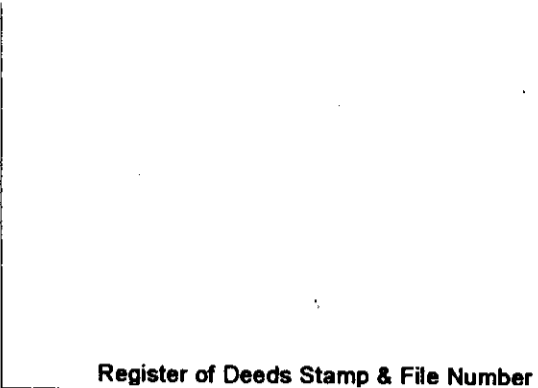

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Apr 03 2003

I, Stephan J. Szyszkoski, in a field survey on _____, 20____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:
 (3-Sec. 1) North 1/16 corner between Sections 1 and 2. Not established in the original survey. Found no subsequent record.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(3-Sec. 1) Established the corner on a straight line between K2 and K1 at an index corrected distance of 1305.34 ft. north of K2. The distance is one-half of that observed between monumented K2 and K3. The corner was not established at 20 chains proportionate measure north of K2 because of a gross error in the original GLO survey measurement between K2 and K1. The position for this corner was computed and monumented using survey traverse points established by and measurement information furnished by Michael Mileski PS, Baraga County Remonumentation Surveyor, Aug-Nov 2001. The undersigned did not measure between the adjacent section and quarter corners during the course of his survey but relied entirely on the data supplied by the Remonumentation Surveyor.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(3) Set 1"IDx32" iron pipe with 4" alum.
 MDNR cap set flush. Blazed, scribed,
 and set measuring nails in:
 16" Spruce N30E 66.55' "1/16S BT"
 13" dbl Ash S32W 55.1' do
 4" Ash S71W 26.55' do
 4" Ash N41W 34.85' do
 Signpost Fire No. B-5808-W N2W 23.9'
 Approx. center N-S road East 7.5'
 Bearings are magnetic. Dist. to trees
 are to a nail and plastic ID tag.



Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 4/3/2003