

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Baraga

(County)

Located In:

Corner Code #

1. Public Land Survey

T 52NR 31W L3  
T 52NR 31W M1  
T R  
T R

2. Property Controlling in Section

S T R  
S T R

3. Miscellaneous Property in Sec.

S T R  
S T R

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

M1 Aug 09 2001

L3 Aug 22 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 20\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

**A. Description of original monument and accessories and/or subsequent restoration:**

(L3) Quarter corner common to Sections 1-12. Established in 1846 by Wm. Ives: East between 1 & 12 40.00 Set qr. Sect. post. Fir 8 N55W 39, Fir 10 S80E 28. Corner shown on 28 Jun 1979 survey by Dennis DeStrampe for Lakes Engineering in Sec. 1 though not labelled as the 1/4 corner. Corner described on 20 Oct 2000 survey by Robert W. Crampton in Sections 1 and 12. Mr. Crampton's position appears to be a retracement of the 1979 survey. 1/2" iron pipe set to replace wood post. Witnessed with survey tag nailed to: 16" Hemlock N27W 12.31', 18" Hemlock S88E 32.82', 9" Hemlock South 27.45', 7" Maple S80W 39.77'. Drawing no. L-3-1355R2.

(M1) Northeast corner of the township. Reestablished in 1972 by A.O. Enger, RLS. 1" I.D. x 36" iron pipe with 4" aluminum cap. Hemlock 17 N27W 29.9', Hemlock 20 N65E 42.0', Hemlock 13 S61E 22.7'. Mr. Enger states he placed this corner 80.00 chains distant from section corners to the north and west. Corner recorded in L1 of LCRCs, P137, Baraga Co. Records.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**


(L3) The original post and accessories were not recovered. Found the 2000 Crampton monument as described, a 1/2" ID iron pipe capped with a plastic cap #24591, in good condition, at record bearing and distance from the accessories noted above. Distance west to monumented corner checks with the original record. Accepted the monument as the best available evidence of the position of the original corner.

(M1) Found the 1972 monument as described, in good condition, at substantial record bearing and distance from the 1972 accessories, recovered in good condition. From this monument I measured 5278.13' west to the NW corner of Sec. 1 (found as recorded) and 5278.90' north to the NW corner of Sec. 31 (found as recorded). Accepted the monument as a careful and faithful reestablishment of the position of the corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

(L3) Found 1/2" ID iron pipe with plastic cap. Found nails with tags in:  
16" Hemlock N27W 12.31'  
18" Hemlock S88E 32.82'  
9" Hemlock South 27.45'  
7" Maple S80W 39.77'

(M1) Found 1" ID I. pipe with 4" aluv. MDOC cap. Blazed and scribed:  
26" W. Pine S77W 46.4' "S1 NBT"  
The 1973 wits:  
16" Hemlock N24W 30.1' overgrown blazes  
21" Hemlock N68E 41.5' do  
16" Hemlock S60E 22.5' do  
Set squared cedar post adjacent.  
Bearings are magnetic. Distances to notch in lower blaze.

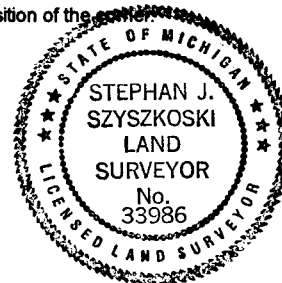

Signed by Stephan J. Szyszkoski  
Surveyor's Michigan License No. 33986

Date 3/19/02