
LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in RECEIVED FOR RECORD THIS 14TH DAY O JANUARY A. D. 1999 AT 10:30 A. M. Baraga Corner Code # Located In: AND RECORDED IN LIBER 5 OF LAND (County) CORNER RECORDATION RECORDS ON PAGE 2 T 52N R 33W 1. Public Land Survey E-12 COUNTY REGISTER OF DEEDS 2. Property Controlling in Section 3. Miscellaneous Property in Sec. Register of Deeds Stamp & File Number 4. Lot No. __ , Recorded Plat 5. Private Claims I, <u>Michael Mileski</u>, in a field survey on <u>September</u>, 19 <u>98</u> do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey 5 instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court-of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below: NOTE: Not more than 2 comers, all in the same town and range, may be recorded on this certificate.

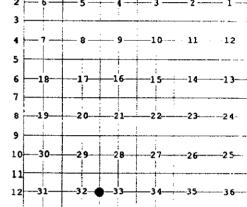

- Description of original monument and accessories and/or subsequent restoration:
- E-12; One-quarter Corner common to Sections 32 and 33, T52N, R33W;

Originally established during U.S. Survey conducted by William Burt, D.S. in 1849 and monumented with a cedar post witnessed by a Yellow Birch 5 N35°E 14 lks. and a Spruce 8 S65°W 13 lks. No subsequent record evidence was found.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- E-12; One-quarter Corner common to Sections 32 and 33, T52N, R33W;

Reestablished this corner midway and on line between the NE corner of section 32 and the SE corner of section 32. The SE corner of section 32 is an original U.S. corner. The NE corner of section 32 was found monumented with a 1" x 24" iron rod at a road intersection (roads to the north, east and west). There is an old fence, mostly fallen, which begins 33 feet south of the NE corner of section 32 and ends at the north edge of Kelsey Creek, this point being 420 feet north of the SE corner of section 32. This fence was found to be, at the nine points located, within 5 feet of a direct line connecting the NE corner of section 32 and the SE corner of section 32. No prominent fence intersections or any other monuments were found at the 1/16 corner positions immediately north and south of the ¼ corner.

- Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- E-12; One-quarter Corner common to Sections 32 and 33, T52N, R33W;

Set a 1" (I.D.) X 36" galvanized iron pipe with cap.

Set 7" spike	N/side	18" Hemlock	N79°E	53.19'
Set 7" spike	E/side	21" Hemlock	S37°W	22.59'
Set 7" spike	S/side	10" Aspen	N87°W	34.56'
Set 7" spike	W/side	16" Sugar Maple	N06°W	59.94'
·	6' Steel fence post w/ yellow sign		North	1.0'

All of the above new bearing trees were marked with upper and lower blazes. The lower blaze was scribed "NBT". Both blazes and a band around the tree at the upper blaze were painted red.



Signed by _ Surveyor's Michigan License No. 39091

APPROVED LAND CORNER

P.A. 345 OF 1990 Baraga County

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971

REVISED MAY 14,1975 REVISED JAN., 1983 REVISED OCT., 1995

LIBER 5

PAGE

9ሴ