

DEC 7 2 40 PM '93

Sandy Schondelmarjan
 REGISTER OF DEEDS

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Barry County
 (County)
Baltimore Township

Located In:

Corner Code #

1. Public Land Survey

T 2N R 8W

F-5

T _____ R _____

($\frac{1}{4}$ corner common

T _____ R _____

to Sections 9 &

T _____ R _____

16)

2. Property Controlling
 in Section

S _____ T _____ R _____

S _____ T _____ R _____

3. Miscellaneous
 Property in Sec.

S _____ T _____ R _____

S _____ T _____ R _____

002107

Register of Deeds Stamp & File Number

4. Lot No. _____ Recorded Plat _____
 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, Kenneth C. Brandt, in a field survey on September 6, 1993, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

GLO: 10" Birch S.4° E. 21 L

14" B.E. N.10 $\frac{1}{2}$ ° W. 8 L

Barry County Road Comm: found Iron

20" Cherry stump W. 1.83'

Fence post E. 11.1'

Fence post N. 12.0'

LCRC #215 dated 7/15/77 by Exxel Engineering (1977) 3/4" Iron found with previous witnesses

Nail in side 14" Maple W. 22.14'

Nail in side 10" Ash E. 30.80'

Fence line to North is 4.5' West of iron PK in center of M-37 - East 207.26 feet.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 3/4" Iron pipe

PK at center line of M-37 & S. line Section 9 East 207.24'

Fence line E & W

Fence line to North - 4.5' West of Iron

SURVEY &
 REMONUMENTATION

APR 05 1994

COMMISSION

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced 3/4" pipe with 3/4" Iron Pin with Aluminum Remon. cap and punch mark.


Nail and Barry County Remon. shiners set as follows:

N. side of 18" Elm S.80° W. 13.29'

NE side of 4" Hickory N.35° W. 30.74'

W side of 14" Maple N.5° W. 73.80'

S. side of 12" Elm S.80° E. 8.63'

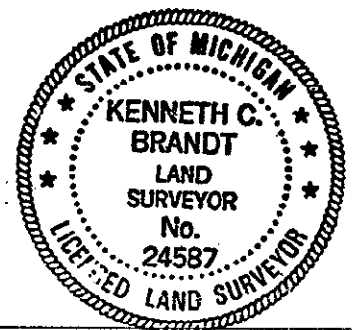

Signed by Kenneth C. Brandt

Date 11/5/93

Surveyor's Michigan License No. 24587