

**SURVEY & REMONUMENTATION**

**FEB 17 1998**

**Barry County Remonumentation  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in **SECTION**

Barry Co.  
(County)

Located In: Irving Twp.

Corner Code #



**2669**  
Page: 1 of 1  
01/02/1998 07:49A

Sandy Schondelmayer - Barry Co. LCRCR

- |                                    |                           |             |
|------------------------------------|---------------------------|-------------|
| 1. Public Land Survey              | T <u>4</u> N R <u>9</u> W | E- <u>9</u> |
|                                    | T ___ R ___               | ___         |
|                                    | T ___ R ___               | ___         |
|                                    | T ___ R ___               | ___         |
| 2. Property Controlling in Section | S ___ T ___ R ___         | ___         |
|                                    | S ___ T ___ R ___         | ___         |
| 3. Miscellaneous Property in Sec.  | S ___ T ___ R ___         | ___         |
|                                    | S ___ T ___ R ___         | ___         |

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Robert Jonker, in a field survey on 10-19, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O., 1830, S.Sibley, D.S.	1878, Bowen, Found old stake	1909, Cobb
W. Oak 12 S 32° W 20	Stake & stone	page 363
W. Oak 22 N 32° E 50	Sugar 3, N47½W 67	Fd. stone in place
	W. Oak S 3¼E 3.75	

L.C.R.C. #218 & survey rec. in L.001, P.406  
Pat McCloskey #16048  
Set iron by occupation

**ACT 345 BARRY COUNTY REMONUMENTATION  
APPROVED BY PEER REVIEW AT A MEETING HELD ON**


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

The corner position as recorded in L.1, P.406 was established using BRIAN REYNOLDS IR COUNTY SURVEYOR procedures and is not utilized in this survey.  
With county road ocm. grader scraping the intersection, found @ 6" below grade, pointed stone set on end in circle of small stone around it, stone had pieces of broken red brick around it, and it also had red marks on its sides, it appeared that the stone had been scraped with the pieces of red brick before placement. Stone was in an area of discolored soil, while further away the soil under the gravel roadway was not discolored.  
Cobbs survey of 1909 shows ½ mile, S¼ to SE of 2630.1', we measure 2630.74

Accepted as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced with 36" long standard Barry County monument.  
Remon tag on S. side 36" Oak Az. 105° 62.14'  
Remon tag on SW side 20" Oak Az. 140° 89.91'  
Remon tag on N. side 22" Oak Az. 240° 70.25'  
Remon tag on S. side 30" Maple Az. 300° 57.93'  
C/L road is 2' West  
C/L of road to West is 4' North  
Position of point recorded in L.1, P.406 was not recorded by us.  
It was dug out while excavating for the stone.

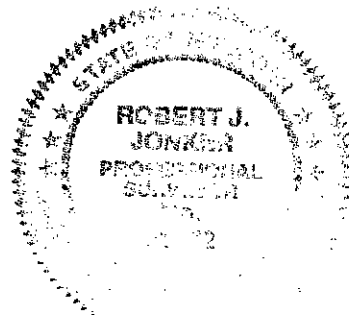

Signed by Robert J. Jonker  
Surveyor's Michigan License No. 21572

Date November 18, 1994