

1993

COMMISSION

BARRY COUNTY REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN COUNTY OF BARRY RECEIVED FOR RECORD

JUL 20 11 20 AM '93

Sandy Schondelmarjer REGISTER OF DEEDS

For corners in

BARRY

(County)

Located In:

Corner Code #

- 1. Public Land Survey T 4N R 9W G-7 IRVING TOWNSHIP COR. SEC. 15,16,21,& 22
2. Property Controlling in Section S T R
3. Miscellaneous Property in Sec. S T R

002059

Register of Deeds Stamp & File Number

- 4. Lot No. , Recorded Plat
5. Private Claims

Grid table with columns A-L and rows 1-13. A dot is marked at the intersection of column G and row 8.

BRIAN REYNOLDS

JUNE

93

I, in a field survey on , 19 , do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

Lee Cobb (Book ix Pg. 112 - 115) "... corner ... in dispute and obliterated ...". Cobb ran right lines from F-7 to I-7 and from G-6 to G-8 and "Set stone 20 x 11 x 6, cross on top and brick". : Pine 9 N72 1/2W 76 NE cor. Town Hall S31W 72

"NOTE : The N & S line, & E & W measurment checked within 1 link; The E & W line, N & S measurment checked within 3 links".


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

TOWN HALL FRAME IS LONG GONE, BUT CUT STONE FOUNDATION IS STILL QUITE INTACT. FROM NE. CORNER OF FOUNDATION MEASURED BEARING AND DISTANCE; FOUND ROTTED REMAINS OF FENCE CORNER. DUG AND AT 1'+/- BELOW GRADE FOUND TOP OF STONE AS DESCRIBED BY COBB, NOT UPRIGHT, LISTING HEAVILY TO THE SW.. DUG FURTHER UNTIL STONE COULD BE PUSHED UPRIGHT. RECHECKED DISTANCE TO FOUNDATION, WHICH CHECKED FAVORABLY WITH COBB'S DISTANCE. CHECKED BEARING AND DISTANCE FROM STONE FOR "PINE" WITNESS. FOUND 40" PINE STUMP IN ADVANCED STAGE OF DECAY.

SET 1/2" IRON RE-ROD W/"REYNOLD'S" CAP: N&T - 24" PINE - N15W - 38.5' - 18" OAK - N45E - 54.0' - TWIN ASH - S50E - 51.8' CORNER OF CUT STONE FOUNDATION - S30W - 47.3'

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

AT LATER DATE SET BARRY Co. REMON. MONUMENT: FOUND AND CHECKED REYNOLDS WITNESSES; TOOK NEW ONES. E. FACE - 12" BLACK WALNUT - N21W - 13.35' SW. FACE - 16" BLACK WALNUT - N62W - 21.35' S. FACE - 10" BLACK WALNUT - S72W - 25.53' E. FACE - 12" BLACK WALNUT - S18W - 23.84' N. FACE - 6" ASH - N78E - 34.46' +/- 15' W. OF C/L ENGLE Rd.

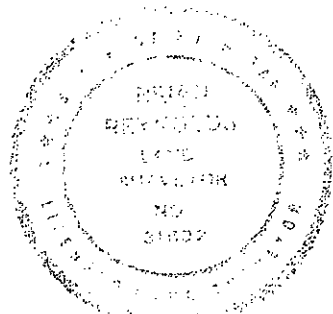

Signed by [Signature] Surveyor's Michigan License No. 31602

Date 7-13-93