

MAR 17 1999

SECTION

REMON. COR. F-13, WILLIAMS TWP. LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in Bay (County)

Table with columns: Located in: Corner Code #. Row 1: T 14N R 3E, F-13. Subsequent rows show T, R, S, T, R, S, T, R.

- 1. Public Land Survey
2. Property Controlling in Section
3. Miscellaneous Property in Sec.
4. Lot No. Recorded Plat
5. Private Claims

REGISTER OF DEEDS BAY COUNTY, MICHIGAN 1998 DEC - 7 A 8:38 RECORDED Register of Deeds Stamp & File Number


I, JERRY JONES, in a field survey on June 26, 1998, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned on lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Grid table with columns A-M and rows 2-13. Contains numbers 1-36 in a grid pattern.

A. Description of original monument and accessories and/or subsequent restoration:

F-13 South 1/4 corner of Section 33 on South Townline Survey by Glo. Joseph Wampler, 1822, set post Survey by Edmands Engineering 1974, 1975, found 1/2" rod LCRC by J. Martin 1976, found 1/2" Iron (rerod)

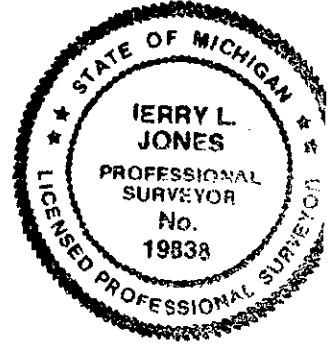

WITNESS NOTE: Witnesses from above surveys and LCRC's are available in dossier file; which was presented to peer review committee and is on file at the Register of Deeds Office.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

F-13 South 1/4 corner of Section 33 on South Townline Found 3/8" rod in mon box (dug 3' found nothing) per surveys by Edmands Engineering and LCRC by J. Martin.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-13 South 1/4 corner of Section 33 on South Townline Found 3/8" rod in mon box per surveys by Edmands Engineering and LCRC by J. Martin. Replace rod with 5/8" rod with brass cap stamped Bay County Remonumentation PS 19838 and is accepted as the best available evidence of the position of the accepted corner. N 50 Deg E, 58.73', nail and BC disc in power pole N 2 Deg E, 51.52', nail and BC disc in power pole (Rec. 51.5) S 40 Deg W, 77.42', northwest corner of house (Rec. 77.36) S 20 Deg E, 73.77', northeast corner house (Rec. 73.80) S 60 Deg W, 77.46', nail and BC disc in 30" Maple East 43.42', 3/4" pipe in mon box (1/4 corner Saginaw Co.) (F-1, T 13N - R 3E)

APPROVED LAND CORNER P.A. 345 OF 1990 - Bay County Date 24 Sept 98 MJM Michael MacDonald P.S. County Representative

Signed by Jerry L. Jones Date 12/01/98

Surveyor's Michigan License No. 19838