

**BAY COUNTY REMONUMENTATION
LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>BAY COUNTY</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T16N R3E	M-9
	T16N R4E	A-9
	T ___ R ___	___
	T ___ R ___	___
2. Property Controlling in Section	S ___ T ___ R ___	___
	S ___ T ___ R ___	___
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	___
	S ___ T ___ R ___	___

Register of Deeds
 BAY COUNTY, MICHIGAN
 DEC 30 3 40 PM '97

RECORDED

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, Paul M. Ciosek, in a field survey on JUNE 19, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- M-9
- POST SET BY J. WAMPLER D.S. 1822
HEMLOCK 30° S 60° W 6 LINKS
HEMLOCK 20° NORTH 22 LINKS
CORNER IS COMMON WITH A-9, T16N, R4E
 - SURVEY, L. 657, P. 279, DELAMATER(7/7/71) FOUND CORNER
 - SURVEY, L. 779, P. 407, MCGINNIS, (1/20/76) FND 1/2" BAR
 - LCRC, L. 2, P. 270, MACDONALD, (3/2/76) FND 1/2" IRON
 - SURVEY, L. 1257, P. 578, CIOSEK, (12/8/92) FND 1/2" IRON

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

M-9
SEARCHED THE APPARENT LOCATION OF THE CORNER AND FOUND 5/8" REROD 6" BELOW ASPHALT ROAD SURFACE. DUG 30" BELOW ROAD SURFACE INTO 6" OF CLAY. FOUND NO OTHER OBJECTS. ACCEPTED 5/8" REROD AS THE BEST AVAILABLE EVIDENCE OF THE POSITION OF THE ORIGINAL CORNER.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

M-9
REPLACED FOUND 5/8" REROD WITH A 5/8" x 24" REROD AND REMONUMENTATION CAP WITH 3/16" DRILL HOLE IN MONUMENT BOX.
N 30°E 42.79' SET NAIL AND TAG IN SOUTH FACE OF 6" SQUARE WOOD POST
N 19°E 115.84' FOUND PK IN WEST FACE PP
S 40°E 49.60" SET NAIL AND TAG IN NE FACE PP
S 40°W 48.96' SET NAIL AND TAG IN NW FACE PP
N 45°W 29.49' SET CAPPED 3/8" REROD
N 45°E 36.04' SET CAPPED 3/8" REROD

Signed by Paul M. Ciosek Date 12/22/97

Surveyor's Michigan License No. 25835

FIELD BOOK , PAGE 75

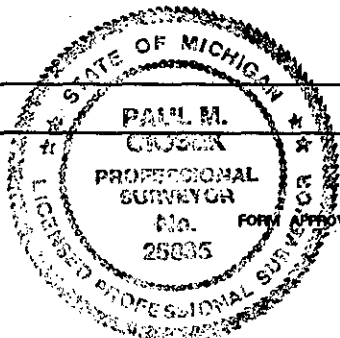

APPROVED LAND CORNER
P.A. 345 OF 1990 - Bay County
Date 27 June 97
MJM
Michael MacDonald P.S.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1871
REVISED MAY 14, 197
REVISED JAN., 198
REVISED OCT., 199

004 88