0	SURVEY &
	MONUMENTATION

## **Bay County Remonumentation**

MAR 3 1 1096

## LAND CORNER RECORDATION CERTIFICATE

LIBER	003	PAGE	28
-------	-----	------	----

	Daile Colli	TEN HEODIDANDION CENT	I IOAIL	oen ww		(ن) ښکا
For corners In MINISSIC	Filing Requi	irement of Act 74, Mich. P.	.A. 1970	X.		
Вау	Located In:	Corner Code ##		REGI NEGI	Dec 22	
(County)				NING.	2	33 CT C)
Public Land Survey	T <u>17N R 4E</u> T <u>17N R 4E</u> T R T R	E-1		Roughous Andrews	16	GORDED
	S T R			NY S	යු	
3. Miscellaneous	S T R S T R S T R		Register of Dee	ds Stamp	& File Nu	ımber
4. Lot No , Reco	orded Plat		` A R C	D E E	GHI	JKŁŅ
5. Private Claims		, The state of the			ĬÏ	֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓֓
٠,			3	111		
Craig W. McVean	Augun a field survey on	ust 31 93	4	- 89-	10-	-1112
do hereby certify that under require in lines 1 and 2 above were In co- current manual of survey instruction	ements of P.A. 74, Michigan P. Informance with regulations a Insome on the United States Department	A. of 1970, the corner points menti- and rules therefore as required in artment of the Interior, Bureau of	oned 6 18 18 18 18 18 18 18 18 18 18 18 18 18	-1716	-15	-1413
Management or by a decree of a Co above were in conformance with the Court of Law; established, re-ea	ne rules of the Michigan Board	d of Land Surveyors or by a Decree	e of a	-2021	22	23 - 24-
expressed below:			10 -30	-2928		-2625
NOTE: Not more than 4 corn on this certificate.	ers, all in the same town	and range, may be recorded	12 31	-32 -33-	34-	35-36-
A. Description of original mor	nument and accessories a	and/or subsequent restoration	13 <u> </u>	<del>-+  </del>	- <del></del>	

Arenac County Surveyor notes - 1905, 1907 and 1923 - Post

distance and angle ties N, E, and W. L.C.R.C. - L. 2, P. 279 - 1977 -McGinnis **Bay County** 

Records.

Recorded Surveys - L. 762, P. 155 - 1975; L. 752, P. 336 -

1974; L. 897, P. 279 - 1980 - Bay County Records.

E-1 Intersect N boundary at post - J. Burt, 1843.

Maple 10" S 42° W 17 Lks.

W. Pine 14" S 45-1/2° E 25 Lks.

Recorded Survey - L. 1, P. 421 - 1981 - Arenac County


Records
Description of corner evidence found and/or method applied in restoring or reestablishing corner:

E-1 Standard corner common to Sec. 32 & 33, T18N, R4E, and Sec. 4&5, T17N, R4E. Found 3/8" rebar per L.C.R.C. - L. 2, P.275 and recorded surveys. Monument accepted as the best available evidence of the position of the original corner. Accepted by Bay County Peer Review Group on 10-21-93.

F-1 1/4 corner common to Sec. 4, T17N, R4E. Found capped 1/2" x 18" rebar per recorded survey and set by split distance measurement between E-1 and G-1, T17N, R4E. This position not established by original government surveyors. This monument is accepted as the best available evidence of the position of the corner. Accepted by Bay County Peer Review Group on 10-21-93.

F-1 Not set in original survey.

Recorded Survey L. 1183, P. 356 - 1990 - set 1/2" rod.

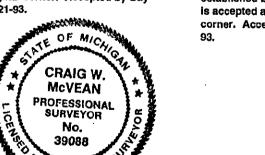

O Statestante C. Description of monument for corne stablished to perpetuate locating the position of the corner:

E-1 Replaced 3/8" rebar with 3-1/4" Bay-Arenac County brass cap on 5/8" x 24" rebar in mon. box.

N 18° W 48.83' to PK and tag in SE side U.P.

N 73° E 42.72' to capped 3/8" rebar.

S 27° E 52.62' to PK and tag in W side U.P.

S 57° W 30.67' to PK and tag in W end concrete culvert.

S 72° W 39.30' to PK and tag in N side 24" Cottonwood.

F-1 Replaced capped 1/2" x 18" rebar with 2-3/4" Bay County brass cap on 5/8" x 24" rebar in mon, box - down 0.75'.

N 2° E 120.92' to nail and tag in W side 12" Ash.

N 80° E 110.90' to nail and tag in W side 8" Elm.

S 68° E 182.96' to nail and tag in N side U.P.

S 83° W 203.92' to nail and tag in N side U.P.

W 5.90' to 3" Arenac County brass cap (F-13 - T18N - R4E).

Date Surveyor's Michigan License No.