SURVEY & REMONUMENTATION

SEP 3 0 1999

S	EC		Ŋ,
البيد	1000 m	f f	TM.

LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

LIBER 2 PAGE 38

Fo	or corners in			
Benzie		Located In:	Corner Code ≠≠ .	STATE OF HICHIGAN
1.	Public Land Survey	725N R 13W T25N R 14W	A-11 M-11	RENZIE COUNTY RECORDED
	•	T R T R		29 DEC 94 4:43 P.M.
2.	Property Controlling in Section	T R S T R S T R		MICHELLE R. GRAY REGISTER OF DEEDS
3.	Miscellaneous Property in Sec.	S T R S T R		Register of Deeds Stamp & File Number
4.	Lot No , F	Recorded Plat		
5.	Private Claims			


1, John B. Smendzuik, in a field survey on December 16 and 22, 19_ do hereby certily that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

10 11 12

- A. Description of original monument and accessories and/or subsequent restoration:
- G.L.O. set post 28" Hemlock N72°W 21.12', 6" Sugar S18°W 3.30'. 1890 George Steele, G.C.A. Book 3, Page 52,"set ironwood stake, expect to set iron and NBT." James Pettit, Surveyor's Record II, Page 30 - 1 1/2" gas pipe set by stumps of original bearing trees. Frank Haswell, Surveyor's Record II, Page 64, iron pipe driven. 1970 - B.C.R.C. found 1 1/ pipe. 1984 - B.C.R.C. set railroad spike after repave.
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- Found railroad spike not quite over 1/2" boat spike driven in 1" iron pipe driven in 2" x 3 iron pipe over top of 1/2! iron pipe. Total length of iron from top to bottom = 62".

Ratified by Peer Group In accordance with P.A. 12/21/94 Date.

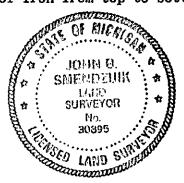

- Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- Replaced total length of iron with 3" \emptyset concrete monument with Benzie County Remonumenta-**I-11:** tion Program Brass Cap. Monument box to be set in 1995 during repaving project.

22" Cottonwood N63°W 53.21' 10" Red Pine N41°W 60.41 12" Red Pine S36°E 41.84* Twin 18"Cottonwood S65°W 71.43'

All measurements made to double headed nail with brass tag stamped Benzie County

. Hotel With median continue made as assume normal made	was was as and any and as a second
Remonumentation Program n	•
signed by TORB. Road	Date12 24 94
iurveyor's Michigan License No. 30895 8	CORM SARROUGH BY MINIMAN STATE BOARD OF LAND SURVEYORS. IAU OR AND