

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In:
Benzie Located In _____ Corner Code # _____
 (County)


- | | | | | | |
|--------------------------------------|---|-----|---|-----|----|
| 1. Public Land Survey | T | 25N | R | 14W | C4 |
| | T | | R | | |
| 2. Property Controlling in Section | S | | T | | |
| | S | | T | | |
| 3. Miscellaneous Property in Section | S | | T | | |
| | S | | T | | |

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Craig W. McVean, in a field survey on July 8, 2009 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

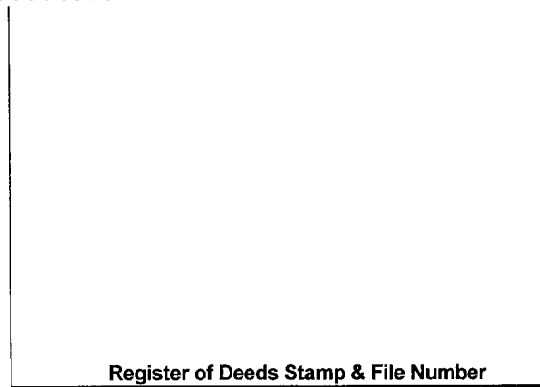

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		●	8		9		10		11		12	
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- C4 – 1838 – GLO – Alvin & Austin Burt – Set ¼ Post
- 1) Beech 6" N78°W 17 L.
 - 2) Hemlock 34" S84°E 18 L.
- 1979 – LCRC – L. 1, p. 62 – C. F. Roser
- Re-established ¼ Cor. Equidistant and on line between Sec. Cor.'s. to N & S. This fits fd. 1/8 Cor. ¼ mile S. and fits 1/8 Cor. position ¼ mile N. per Rec. Plat Dist. (W. line N ½ - NW ¼ S-8, Orchardville No. 3).
- Set DNR Mon. & Cedar Post.
- 3) 6" Cherry S45°W 20.7'; 4) 12" Maple S16°E 15.4';
 - 5) 4" Ironwood in Clump N62°E 27.4'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

C4 – ¼ Corner common to Sections 7 & 8, T25N, R14W – Fd. 3 ½" "State of Michigan" Alum. Cap on 1" x 36" long iron pipe per Roser. No GLO evidence. Witnesses #3 and 4 are stumps. Witnesses #5 is OK. Centerline N-S 2-track is 85± West. DNR Mon. accepted as the best evidence of the position of a locally accepted corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- C4 – Replaced DNR Monument with stamped 3" Benzie Co. Remonumentation Brass Cap on ¾" x 36" iron pipe encased in 4" x 36" concrete cylinder.
- Set Blue Carsonite Post 1' SW.
- N62°E 27.50' to set N & T in N. side 6" Ironwood in Clump (#5)
- S32°E 53.46' to set N & T in E. side 6" W. Pine scribed 'XBT'
- N88°W 26.70' to set N & T in Tw. 5" & 7" Sugar Maple scribed 'XBT'
- N3°E 27.13' to set N & T in W. side 15" Sugar Maple



Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 1/7/2010