

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>26</u> N. R. <u>13</u> W.	C-9; C-10
2. PROPERTY CONTROLLING IN SECTION	<u>29</u> T. <u>26</u> N. R. <u>13</u> W.	8; 3
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. R. _____ W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on July 28, 1980, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

XX

C. Continued. :

3	C-9
Drove 5/8" re-rod w/RLS Cap (Buried 0.5)	Fd 1 1/4" pipe in Poured Conc.
16" Oak N82°E 51.8	Added Ced. Post w/loc Tag
8" Oak S74°W 48.4	25" Oak S89°E 42.4
4" Maple (twin) N34°W 23.1	18" Oak N34°E 79.0
Cor. is in ctr. of N-S Tr. Rd.	12" Oak S75°W 50.0
Set Ced. Post w/loc Tag E. 33'	Ctr. N-S Tr. Rd. W. 9'±
	Ctr Tr. Rd. SE N. 100'±

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 8 Established W 1/8 cor. on E-W 1/4 line, Sec.29, equidistant & on line between fd.ctr.& W 1/4 Cor. of Sec.29; per 1927 plat of "Turtle Lake Resort". The ctr of a dirt rd to Turtle Lake is West, 75'±.
- C-10 Recovered old subdivision monument (1 1/2" pipe set in conc.) per 1927 plat of "Turtle Lake Resort". Corner is 1.5'-N. of S. edge of E-W bit. surface road.
- 3 Set 1/8 cor. per standard BLM instructions. Fd conc. plat Mon. "Turtle Lake Resort" by T. Norlin, 1926, S00°24'W 8.44' (on Sec.Line).
- C-9 Recovered old subdivision monument (1 1/4" pipe set in conc.) per 1927 plat of "Turtle Lake Resort".

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

8	C-10
Drove 1"x18" Solid Iron Rod.	Fd.1 1/2" pipe in conc; raised w/3/4 pipe flush w/rd.
6" W. Pine N27°W 58.4	10" Oak (Twin) N35°E 73.1
13" Oak (Twin) N25°E 57.2	15" Oak N35°W 65.2
11" Oak S19°E 56.9	Fd 1" pipe in conc. S39°E 46.11
Ctr. E-W B.Top Rd. N 6.5'	Set Ced. Post w/loc Tag S 33'
Set Ced.Post w/Loc Tag S 26.5'	Ctr. E-W Bit. Rd. N. 9'±
Fd."Turtle Lake Resort" mon S37°04'E 40.97	Ctr Trail Rd nly E. 45'±


SIGNED BY Carl F. Roser 2/20/81 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

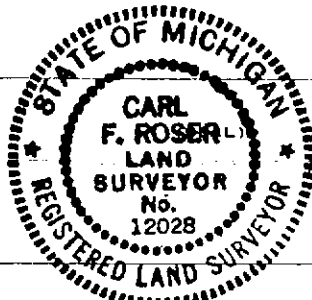

(SEAL)

Inland Township
BENZIE COUNTY

SURVEYOR'S MICHIGAN REGISTRATION NO. _____