

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

LIBER 2 PAGE 272

For corners in

Form with fields: Benzie (County), Located In, Corner Code #, 1. Public Land Survey, 2. Property Controlling in Section, 3. Miscellaneous Property in Sec.

STATE OF MICHIGAN
BENZIE COUNTY
RECORDED

5 JAN 2000 3:29:02 PM
MITCHELLE R. GRAY
REGISTER OF DEEDS
# PAGES One

Register of Deeds Stamp & File Number

4. Lot No. , Recorded Plat
5. Private Claims

I, David T. Rowe, in a field survey on October 15, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Grid table with columns A-M and rows 1-13, containing numerical data points.

A. Description of original monument and accessories and/or subsequent restoration:

L-5: 1/4 Corner Common to Sections 12 and 13:
G.L.O. Notes: 1839 Set 1/4 Section Post- 12" Beech S20°E 22 lks. , 5" Ironwood N59°W 27 lks.
County Records: 1868 G. Steele- Reset from old bearing trees. Set hemlock stake with 5 stones and broken earthenware around it at the depth of 2'.
1975 H. Bruning L. 1 Pg. 385 Calculated position on line between section corners
1976 H. Bruning Set P.K. nail from previous survey. Maple 8" S16°W 31.60'- Twin Red Pine 8" N36°E 74.55'- Red Pine 8" N6°W 57.62'- P.K. nail E. 2.33'


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

L-5: 1/4 Corner Common to Sections 12 and 13:
1999 P.K. nail was destroyed during road construction. Measured between section corners and reset P. K. nail according to Bruning survey. The Benzie County Peer Group accepted the position by Bruning as being the best evidence of a locally accepted corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-5: 1/4 Corner Common to Sections 12 and 13:
P. K. nail replaced with 3/4" i. d. galvanized 36" long iron pipe with a stamped brass cap in a monument box 0.6' S. of centerline US-31
Witnesses: N2°W 58.18' Fd. Spike W. Face 14" Red Pine
N23°W 70.75' Fd. Spike E. Face 12" Red Pine
S20°E 33.37' Fd. Spike NE Face Multi-stem (4) 8" Maple
S16°W 32.06' Fd. Spike W. Face Twin 10" Maple

Ratified by Peer Group
In accordance with P.A. 345
Chairman [Signature]
Date 11/9/1999

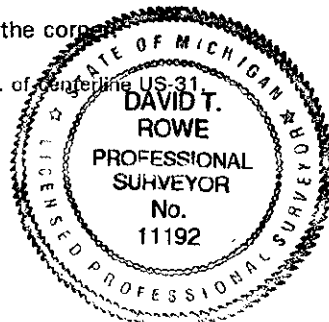

Signed by David T. Rowe
Surveyor's Michigan License No. 11192

Date