


**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>Benzie</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>26N</u> R <u>15W</u>	<u>L-3</u>
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

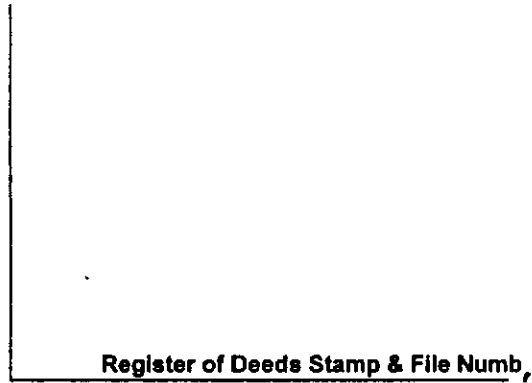

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

I, Craig W. McVean, in a field survey on Jan. 28, 19 98 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3											●	
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

**NOTE:** Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

**A. Description of original monument and accessories and/or subsequent restoration:**

- L-3 -GLO - Set post - Alvin Burt - 1839  
Cedar 12" S2°W 35L  
Do 14" N19°W 12L
- Co. Bk., P. 158-159 - F. Haswell - 1896  
FND. old witness trees blown down & almost gone.  
Pine 8" S1°W 31L  
Tamarack 8" N40°E 18L
- Assessor's Plat of Miner's Bay - H.J. Kleinhuzen - 1955  
Set Conc. Mon., 1/2" Iron Rod in 4"x48" Conc.
- Rec. Survey L.1, P. 883 - R.M. Harris - 1986  
FND. Conc. Mon.
- Rec. Survey L.2, P. 738 - B. Jenema - 1996  
FND. Iron.

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

L-3 - 1/4 Corner common to Sec.'s 1&12, T26N,R15W. FND. 1/2" Iron in Conc. Mon. on W. edge gravel road, down 1.2'. Monument has been used in Plat & Rec. Surveys. Monument accepted as the best available evidence of the position of the original corner.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

- L-3 - 1/2" Iron in Conc. Mon.  
\*S24°W 9.26' to set N&T in E. Side 12" Tamarack  
N30°W 21.99' to set N&T in SW. Side 8" R. Maple (Clp. 5)  
\*N85°E 34.03' to set N&T in N. Side 12" Hemlock  
East 32.96' to P.S. Cap # 25850 on 1/2" Rebar - Add blue Carsonite post.  
S47°E 46.09' to fnd. spike, N. Side 11" Hemlock
- \*Nail by others above.



Signed by Craig W. McVean  
 Surveyor's Michigan License No. 39088

Date 10/6/1998