

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 26 N. R. 16 W.	I-13;J-13;L-13;M-13
2. PROPERTY CONTROLLING IN SECTION	T. S. R. E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 10, 1976, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. (continued)

M-13 Fd. 1/2" pipe at intersection of b'top rds. E-W-S. Accepted as corner common to T25&26N, R15&16W. Corner is in line w/old fn. to N & fits old surveys by Steele & Haswell.

C. (continued)

M-13

Fd. 1/2" pipe
 4" W. Birch S19°W 124.24
 6" W. Birch N67°E 88.30
 Set cedar post w/loc. tag Due N 33'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

I-13 Accepted existing SW corner Sec. 35 as previously monumented.
 J-13 Restored S 1/4 cor. Sec. 35, 11/88' (18 links) E of fd. stake & C.I. stove box (buried) per 1871 survey of Sec. 2 (25-16) by G. Steele, old survey record I, p.100. Restor. by this method fits 1/4 cor. pos. single proportion within 0.42'. The Benzie Co. Mon. in Mon. box for N 1/4 corner Sec. 2 (25-16) looks very reasonable for pos. by single prop. & MSHD survey notes say they fd this for N 1/4 Sec. 2 not as MSHD plans erroneously call cor. to Sec. 2 & 35. This surveyor would not want to settle on proper N 1/4 Sec. 2 w/o complete survey of Sec. 2.

L-13 Reestab. S 1/4 cor. equidistant bet. recovered SW & SE of S-36 & on line across the SW S-36 & fd. N 1/4 S-1 (25-16). A straight line pos. bet. Sec. cor. would be 0.4' N. Haswell survey of Sec. 36, 1910-1915+ indicates S 1/4 S-36 as being midway & on line bet. sec. corners to E & W.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p>I-13 Fd. Benzie Co. Mon. in Mon.Box P' Pole N03°E 86.00 P' Pole S30°E 45.85 (25-16) in mon. box NW cor. S-2 Benzie Co. Mon. S89°51'E 3.14 Ctr. E-W b'top rd. Due N 6'± RLS#10681 rerod w/cap Due N 33'</p>	<p>J-13 Drv. 1 1/4"x20" iron pin 20" Maple Due N 29.0 17" Maple N51 E 46.17 Benzie Co. Mn. in Mon.Box N89°51'10"W 5.08 MSHD Rd. PI fd. boat spk. N73°20'E 5.12 Drv. 3/8"x33"ir. over fd. stk. & CI stove box 3/5' dp. N87°12'W 11.89 Fd. large angle iron N01°45'E 31.3</p>	<p>L-13 Drv. 1 1/4"x18" iron pin P' Pole N53°W 47.16 9" Cedar N40°E 56.28 Ctr. E-W b'top rd. Due N 1.8'± Ctr. b'top rd. to S Due W 4'± N 1/4 S-1 1 1/4"x18" iron pin (25-16) N89°54'W 3.97</p>
---	---	---


SIGNED BY Carl F. Roser DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY _____ DATE _____

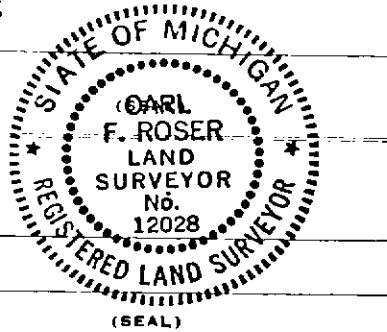

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ BENZIE COUNTY