

# SURVEY & REMONUMENTATION

APR 24 1995

LIBER 2 PAGE 24

## COMMISSION

### LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Benzie

(County)

Located In:

Corner Code ≠#

- |                                    |   |            |   |            |             |
|------------------------------------|---|------------|---|------------|-------------|
| 1. Public Land Survey              | T | <u>26N</u> | R | <u>16W</u> | <u>L-11</u> |
|                                    | T | _____      | R | _____      | _____       |
|                                    | T | _____      | R | _____      | _____       |
|                                    | T | _____      | R | _____      | _____       |
| 2. Property Controlling in Section | S | _____      | T | _____      | _____       |
|                                    | S | _____      | T | _____      | _____       |
| 3. Miscellaneous Property in Sec.  | S | _____      | T | _____      | _____       |
|                                    | S | _____      | T | _____      | _____       |
4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims \_\_\_\_\_

STATE OF MICHIGAN  
BENZIE COUNTY  
RECORDED

29 DEC 94 4:41 P.M.

MICHELLE R. GRAY  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

I, John B. Smendzuik, in a field survey on December 15, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:

L-11: G.L.O. set post - 13" Beech S25°E 27.06, 6" Beech N9°E 25.08'. Surveyor's Record II, page 128, Section break of section with numbers along north line. 1977 - Carl Roser/DNR reset corner <sup>ON</sup> line between section corners and at prorated distances to section break on record. Filed act 74. 1980 - Plat of Skyway Park shows concrete monument set at corner.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


L-11: Found cap and concrete monument which fit DNR witnesses and Plat of Skyway Park.

Ratified by Peer Group

In accordance with P.A. 345

Chairman J.B. Smendzuik

Date 12/19/94

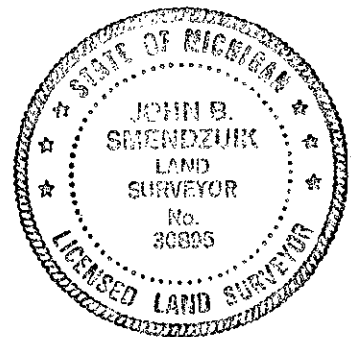

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-11: Replaced Concrete monument with 3" Ø concrete monument with Benzie County Remonumentation Program Brass Cap. Corner is 5" below grade of gravel roads in 'T' intersection.

12" Red Pine S44°W 70.53'

8" Apple Tree S54°E 54.61'

Power Pole N63°E 36.04'

10" Red Pine with blaze N6°E 46.04'

Note: All measurements made to double headed nail with brass tag stamped B.C.R.P.

Signed by

John B. Smendzuik

Date

12/29/94

Surveyor's Michigan License No.

30895