

**SURVEY & REMONUMENTATION**

MAR 13 1998

SECTION

**BRANCH COUNTY REMONUMENTATION CORNER  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970**

STATE OF MICHIGAN  
Branch County  
Recorded

For corners in

10-22-1997 09:53:50

<u>BRANCH</u> (County)	Located In:	Corner Code #
BETHEL TWP.		
1. Public Land Survey	<u>T 7 S R 7 W</u>	<u>G-1</u>
	T ___ R ___	_____
	T ___ R ___	_____
	T ___ R ___	_____
2. Property Controlling in Section	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____
	S ___ T ___ R ___	_____

Linda Lee Morrison-Mathews  
REGISTER OF DEEDS

Liber **00003** Page **0141**

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, EDWARD W. REED, in a field survey on JUNE 10, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

A. Description of original monument and accessories and/or subsequent restoration:  
NORTHWEST CORNER SECTION 3, NORTHEAST CORNER SECTION 4,  
BETHEL TWP

- 1826: W. BROOKFIELD, DEPT SURVEYOR - CORNER SET
- 1900: C. HAMILTON, CO SURVEYOR - FOUND TAMARACK STAKE IN WRONG POSITION, FOUND STONE AT SW CORNER, FOUND STAKE AT NORTH 1/4 CORNER, RERAN LINE FROM U-S DISTANCE AND RESET CORNER
- 1920: E.L. MINER, SURVEYOR - FOUND WELL TUBE IDENTIFIED BY ELMER PIXLEY AND JABE WOOD AS CORNER.
- 1954: E.R. REED, SURVEYOR - FOUND WELL TUBE
- 1977: E.R. REED, SURVEYOR - FOUND WELL TUBE, RECORDED IN LCRC # 0197
- 1991: D. ANDREWS, SURVEYOR - FOUND WELL TUBE, SET BAR AND CAP IN CI-MONUMENT BOX, RECORDED IN LCRC # II-194

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND 1/2" IRON ROD IN CI-MONUMENT BOX AS DESCRIBED IN LCRC # II-194

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
SET REMON CAP ON 1/2" IRON IN CI-MONUMENT BOX

- NAIL/SHINER IN 24" MAPLE, N50E 74.14'
- NAIL/SHINER IN 4" ELM, S70E 48.96'
- NAIL/SHINER IN GUARD POST, N40W 51.05'
- NAIL/SHINER IN GUARD POST, N10E 78.25'

BRANCH COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 9-10-97


E.R. Reed, P.S., Co. Rep.  
**E.R. REED**

AND IS ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORIGINAL CORNER

Signed by Edward W. Reed  
EDWARD W. REED

Date JUNE 10, 1997

Surveyor's Michigan License No. 33985

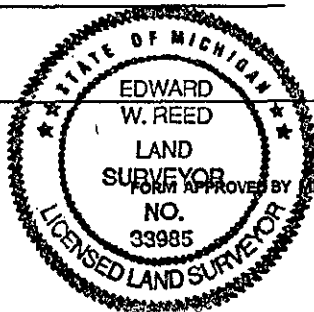

MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28  
REVISED MAY 14, 1975

REVISED JAN. 198  
REVISED OCT. 199