LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 Chippewa County Remonumentation Corner

For corners in

Chippewa County Located in: Corner Code # 1. Public Land Survey TAAN R1W K-9 т Ŕ SURVEY & 2. Property Controlling S REMONUMENTATION in Section S Miscellaneous S R REB 2 3 2001 Property in Sec.

\$7,00 LAND CURNER

\$2.00 MSSR 2 FEB 2001 3:56:29 PM Receipt #1103 RECEIVED FOR RECORD

CHIPPEWA COUNTY - STATE OF MICHIGAN SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 11

Register of Deeds Stamp & File Number


4 Lot No. 5. Private Claims , Recorded Plat

SECTION

I, Keith R. Waters, in a field survey on November 10, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

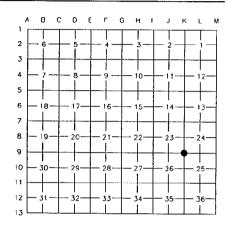

K-9 Corner Common to Sections 23, 24, 25, & 26, T44N, R1W.

1845 - Original corner established by James H. Mullett. Witnesses: Fir 10, N27°E 27 links - Cedar 12, S58°W 07 links.

Chippewa County Surveyor Frederick H. Brown, RLS 944. Notes indicate that the original corner was gone, burned by the great fire of 1856. Made corner from corner to the south.

1921 - Chippewa County Surveyor Frederick H. Brown, RLS 944. Notes reference the corner from 1908.

1925 - Chippewa County Surveyor corner tie book. Brown & Colwell reference a 24" concrete monument.

1971 - Michigan Department of Transportation right-of-way maps for Highway M-48. Corner is shown at Station 798+60.15, 0.27' south of centerline.

1983 - Larry R. Rogers, P.S. 29251, LCRC Liber 6, page 297, Chippewa County corner records. Found a 1" iron in a monument box. Witnesses: Power Pole, N32°E 80.50' - NE Corner of Headwall, S14°E 57.60' -Power Pole (PD4/37), S16°W 80.09' - Power Pole (PD4/38), N18°W 75.49'.

1996 - Certificate of Survey, Liber 717, p. 62, Chippewa County Records. Boat spike in monument box. Witnesses: P. Pole, S15°W 79.95' - P. Pole, N31°E 80.61' - P. Pole, N20°W 75.50' - P. Pole, S44°W 104.76'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

This corner is being perpetuated as part of the Chippewa County Remonumentation Program. Found a 1" iron in a monument box and all record witness objects from the above mentioned 1983 The position fits with other corners as shown on the MDOT right-of-way maps.

PREVACOU EN REVISO E VONENT

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Found a 1" iron in a monument box at the corner location, which falls 0.4'± south of the centerline of Highway M-48, at the intersection of roads north and south.

Witnesses:

Northeast corner of Concrete Headwall, S22°E 57.73'

PK Nail in Power Pole, N30°W 75.49'

PK Nail in Power Pole, N25°E 80.49'

PK Nail in Power Pole, S12°W 80.10'

RIE OF MICHIGAN KEITH R. WATERS PROFESSIONAL SURVEYOR લાડ OFESSIONAL

Keite R. Water

Date 12-29-00

Surveyor's Michigan License No. 33142

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995

PAGE 203