

NOV 07 1994

COMMISSION

Chippewa County Remonumentation Corner

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in
Chippewa
 (County)

Located In:	Corner Code #
T <u>45N</u> R <u>2W</u>	<u>I-6</u>
T _____ R _____	_____
T _____ R _____	_____
T _____ R _____	_____
T _____ R _____	_____
S _____ T _____ R _____	_____
S _____ T _____ R _____	_____
S _____ T _____ R _____	_____
S _____ T _____ R _____	_____

\$ 7.00 LAND CORNER
 \$ 2.00 MSSR
 18 OCT 94 1:07 P.M. RECEIPT# 700
 RECEIVED FOR RECORD
 CHIPPEWA COUNTY - STATE OF MICHIGAN
 SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, William L. Karr, in a field survey on May 20, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

(I-6) 1/4 Corner 15/14
 Original Survey August 4, 1849.

Set Maple post for 1/4 Section Corner.
 Hemlock 12 S 58 E 26 links
 Cedar 6 N 55 W 8 links

1932 : Unknown surveyor could not find 1/4 Corner. Ran North from the Southwest corner of Section 14 and set post.


NBT Pine 24 N 55 E 40 links
 Pine 14 S 24 W 21 links

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(I-6) 1/4 Corner 15/14

This corner is being re-established as part of the Chippewa County Remonumentation Program.

Made a very thorough search for the original bearing trees. Found (2) very large, obvious pine stumps. They were the only ones in the area. The 1932 ties were inconsistent with the stumps. However if you use the N55°E ties and change the other to S24°E they work very well. I used this solution to reestablish the corner:

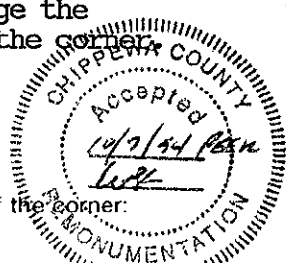

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(I-6) 1/4 Corner 15/14

Corner is a 3/4" rerod with a 2 1/2" diameter stamped cap (Chippewa County).

Ties:	B. Fir 9"	N44°E	45.84'
	B. Fir 5"	S44°E	10.53'
	B. Fir 8"	S23°W	19.23'
	B. Fir 9"	S80°W	25.64'



Signed by William L. Karr Date 1/20/94

Surveyor's Michigan License No. 27450

1576-00

NOTE: Bearings are compass bearings corrected for declination.
 Distances are to a nail in side of witness objects.