

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970 as Amended

For corners in

<u>Chippewa</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>50N</u> R <u>7W</u>	<u>67</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File
Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

Nov 24 2003

I, Stephan J. Szyszkoski, in a field survey on _____, 20____ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:


(G7) Corner common to Sections 15-16-21-22. 1952 - Remonumented by Dean C. DeLaMater, RLS from an original B.T., still in place, down, poor condition. Set 1" pipe with 4" brass cap. 10" H.Maple S47W 27 links, 10" H.Maple N47E 59 links.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(G7) Recovered the 1952 monument in good condition and at record bearing and distance from the remaining NBT Sugar Maple now 16" DBH S47W 27 links, in good condition, no markings visible. The Maple NE was not recovered. No apparent evidence of the original B.T. noted in 1952. Accepted the monument as a careful and faithful perpetuation of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(G7) Found 1" ID I. pipe with 4" brass MI Dept. of Conservation cap. Set measuring nails in:
 16" Maple S47W 17.45' mrkd "S21 NBT" *
 14" Beech S10E 17.8' "S22 NBT"
 10" Beech N20W 5.5' "S16 NBT"
 5" Maple S56E 28.4' "S22 NBT"
 Bearings are magnetic. Distances are to nail with MDNR tag. * denotes 1952 NBT.

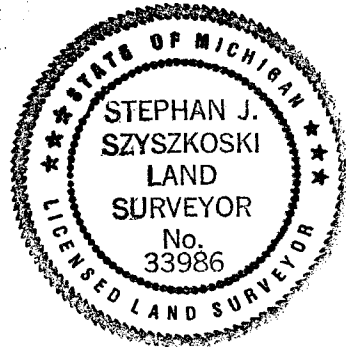

Signed by Stephan J. Szyszkoski
 Surveyor's Michigan License No. 33986

Date 3/12/07

For the Michigan Department of Natural Resources, Office of Land and Facilities