

REMONUMENTATION

NOV 18 1997

COMMISSION

CLARE COUNTY REMONUMENTATION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>CLARE</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T 19N R 5W	A-13
	T 18N R 5W	A-1
	T 19N R 6W	M-13
	T 18N R 6W	M-1
2. Property Controlling In Section	S ___ T ___ R ___	_____
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	_____

RECEIVED
#218-97
97 OCT 15 AM 10:52

REGISTER OF DEEDS
CLARE COUNTY
CAROL A. McCAULAY

GREENWOOD
LINCOLN
REDDING
FREEMAN

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, MARK R. ROBISON, in a field survey on July 1, 1997 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

1838 Nicholson GLO
Int. at Post 77.80 East of 1/4 Corner
Wit-Beech 8" S60E 23
Beech 6" S73 1/2W 15
Beech 10" N12W 34

1856 Cannon - resurveyed
Twp Cor Meas 84.91 ch N of Sec Cor

No CSR records

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Established approximate position by S.P.M. between known corners at A-5, T19N, R5W, and A-11, T20N, R5W. Found and held very old 2" pipe 3.5 ft. North of S.P.M. New fence corner (East & South) is 37 ft. South of Corner. Measured North 5275.94 (GLO 5280) to section corner. Measured East 2491.27 (GLO 2494.8) to 1/4 Corner.

See dossier for detailed report.

APPROVED LAND CORNER
P.A. 345 of 1990
Clare County


Chairman [Signature]
Date 9-23-97

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 36" rerod with Clare County Remonumentation Cap marked P.S.#27458 in 2" Pipe. Accepted as best available evidence of a proper restoration of the position of the corner.

Witnesses:

South 36.96', N&T, Cor. F. Post
N84E 118.50', N&T, 30" Oak
N84W 113.54', N&T, 40" Maple
S51W 154.55', N&T, 36" Maple

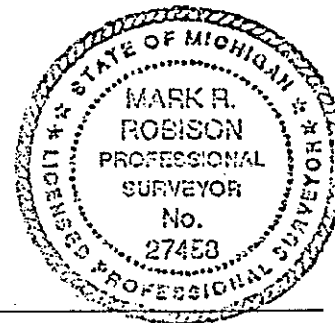

Signed by [Signature]
Surveyor's Michigan License No. 27458

Date 10-01-97