

MAR 29 2000

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

STATE OF MICHIGAN  
 CRAWFORD COUNTY  
 RECORDED

28 DEC 99 3:01 P.M.

SANDRA MOORE  
 REGISTER OF DEEDS

Register of Deeds Stamp & File Number

**SECTION**

For corners in

Crawford

(County)

Located In:

Corner Code #

1. Public Land Survey	T <u>28N</u> R <u>4W</u>	<u>F-10</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_ **LIBER 4 PAGE 65**

I, Marvin E. Myers, in a field survey on July 22, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

**NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**

Not Set by GLO  
 L1, P61 LCRC Dec 26, 1973 K. Ostling #10068  
 L2, P130 LCRC Dec 26, 1973 K. Ostling #10068  
 Mon - Set DNR Mon at calculated intersection of true ¼ lines 2 ½ feet of 1" pipe  
 L273, P505 1985 C. Robinson #16390 Wit: 6" Maple S49°E 10.2  
 Mon - fd 3' of 1 ½" Pipe 16" Maple S12°E 23.4  
 Wit: 8" Maple S27°E 9.98  
 16" Tw. Maple S2°W 24.50

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

Found 2.5 feet of 1" Iron Pipe; found 16" Tw. Maple S02°W 24.50; E-10 to F-10 N89°15'24"E 2647.16; F-10 to G-10 N89°19'12"E 2706.40; F-11 to F-10 N00°16'51"E 2581.24; F-10 to F-9 N00°11'28"E 2638.62


This position was not established by original government survey. This position is accepted as a determination of the position of the corner. Set Standard Crawford County Monument, replaced pipe.

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

Mon - Standard Crawford County Monument  
 Wit: Spike in NE side 6" Maple S57°E 9.84  
 Spike in W. side 14" Maple S29°E 10.1  
 Spike in W. side 18" Tw. Maple S05°E 24.51  
 Spike in N. side 3" Cherry S50°W 21.49

**CRAWFORD COUNTY**  
**PEER GROUP APPROVAL**  
 DATE NOV 30, 1999

*Marvin E. Myers*  
**Marvin E. Myers, P.S.**  
**County Surveyor**

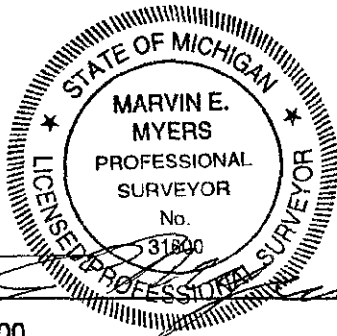

Signed by \_\_\_\_\_  
 Surveyor's Michigan License No. 31600

Date December 22, 1999