

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 33 N. R. 4	F-13; E-12
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S. R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on December 20, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

B. (Continued):

~~A. Description of original monument or accessories and/or subsequent restoration:~~

E-12 - N & S & U.S. call to stream 20 links wide at 45 chains north of SW Cor. of Sec. 33 is non-existent. Suspect that line was actually run south from 3 or 6 miles from north (1841 survey left lot to be desired). A vague corduroy old logging road (SSW-NNE) is south, 24'±. Corner is on true cut-in N-S line. Corner falls at N. edge of 14" Spruce stump that was cut while running N-S Sec. line.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

F-13 - Fd. N. Cor. of Sec. 4, T32N-R4W (S. Cor. Sec. 33, T33N-R4W) per E.A. Robinson survey of North line of Sec. 4 dated May 1906; see Hudson (32-4) Book C-296, pg. 3. Restored cor. from E.A. Robinson N.B.T. (Hemlock stp remains, S64°E, 22.4'). Fits E.A. Robinson tie 10.00 chains East to stream 20 Lks. wide. Any other latitude for 1/4 Cor. would not fit stream tie. Also fits E.A. Robinson distance 1/2 mile east (very close) to fd. SE Sec. 33. E.A. Robinson fd. both U.S. B.T.s at S. cor. of Sec. 4. Fd. Schaaf 2" pipe (dug pipe down flush w/ground), N61°18'E, 98.2'.

E-12 - Re-established 1/4 Cor. mid-way & on line bet. NW & SW corners of Sec. 33. Something in error on U.S. line notes between Sections 32 & 33; distance is way over 80 chains

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-13			E-12		
Set DNR Mon. & Cedar Post			Set DNR Mon. & Cedar Post		
6" Maple	N45°E	31.6'	9" Cedar	N20°E	14.4'
10" Maple	S70°E	31.0'	8" Maple	S30°E	8.6'
12" Maple	S35°W	30.3'	10" Cedar	S05°W	12.4'
14" Twin Maple	N40°W	9.0'	8" Cedar	N45°W	15.9'

SIGNED BY Carl F. Roser 02-07-86 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

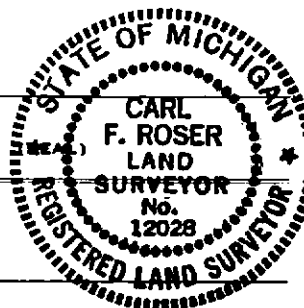

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

CHARLEVOIX COUNTY